

UNITED STATES
DEPARTMENT OF THE INTERIOR
BUREAU OF LAND MANAGEMENT
HOBBS, NEW MEXICO
PERMIT NO. 1950

SUBMIT IN TRIPLA
(Other instructions on reverse side)

Form approved.
Budget Bureau No. 1004-1
Expires August 31, 1985
5. LEASE DESIGNATION AND SERIAL
NM 63368
6. IF INDIAN, ALLOTTEE OR TRIBE NAME

SUNDRY NOTICES AND REPORTS ON WELLS

(Do not use this form for proposals to drill or to deepen or plug back to a different reservoir.
Use "APPLICATION FOR PERMIT" for such proposals.)

1. WELL ☒ GAS WELL ☐ OTHER

2. NAME OF OPERATOR

Hopper-Barnett, Inc.

3. ADDRESS OF OPERATOR

P.O. Box 1706, Hobbs, NM 88240

4. LOCATION OF WELL (Report location clearly and in accordance with any State requirements.
See also space 17 below)
At surface

990' FWL & 2310 FNL, Sec 13, 19S, 32 E

14. PERMIT NO.

15. ELEVATIONS (Show whether DF, RT, GR, etc.)

K. B 3633.2

7. UNIT AGREEMENT NAME

8. FARM OR LEASE NAME

Bondurant Federal

9. WELL NO.

#2
10. FIELD AND POOL OR WILDCAT

WEST TOWNSHIP - VATES - SR

11. SEC., T., R., M., OR BLK. AND
SURVEY OR AREA

Sec 13, 19S, 32E

12. COUNTY OR PARISH 13. STATE

Lea

N.M.

16

Check Appropriate Box To Indicate Nature of Notice, Report, or Other Data

NOTICE OF INTENTION TO

TEST WATER SHUT-OFF



PULL OR ALTER CASING

MULTIPLE COMPLETION

FRACTURE TREAT

SHOOT OR ACIDIZE



ABANDON*

REPAIR WELL

CHANGE PLANS

(Other)

SUBSEQUENT REPORT OF:

WATER SHUT-OFF



REPAIRING WELL

FRACTURE TREATMENT



ALTERING CASING

SHOOTING OR ACIDIZING



ABANDONMENT*

(Other)

(NOTE: Report results of multiple completion on Well Completion or Recompletion Report and Log form.)

17. DESCRIBE IN DETAIL OR COMPLETE OPERATIONS. (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.)

2-11-88-Ran CBL log. Top of cement is at 2,900', perforated 5 shots, 3251-67 and acidized with 500 gallons 15% NEFE. 2-14-88 Set CIBP 3240 and perf. 3159,61,62,63 and acidized W/500 gals 15% NEFE. Swabbed dry, acidized 2200 gallons 7 1/2% NEFE. Swabbed 75% oil cut W/100' fluid entry every 30 minutes.
2-17-88 Perf 3287,8,9,12,13,14. acidized W/500 gallon 15% NEFE. Swabbed H2O.
2-18-88 Set CIBP @3195 and frac W/14,200 lbs of 20-40 sand and 30 tons of Co2.
2-25-88 Put on pump.

18. I hereby certify that the foregoing is true and correct

SIGNED

TITLE

President

DATE

4-11-88

(This space for Federal or State office use)

APPROVED BY

TITLE

DATE

CONDITIONS OF APPROVAL, IF ANY:

*See Instructions on Reverse Side

SJS