

UNITED STATES
DEPARTMENT OF THE INTERIOR
BUREAU OF LAND MANAGEMENT

SUBMIT IN TRIPLICATE
(Other instructions on
reverse side)

RECEIVED

Form approved.
Budget Bureau No. 1004-0135
Expires August 31, 1985

SUNDRY NOTICES AND REPORTS ON WELLS

(Do not use this form for proposals to drill or to deepen or plug back to a different reservoir.
Use "APPLICATION FOR PERMIT" for such proposals.)

OIL WELL ☒ GAS WELL ☐ OTHER ☐

2. NAME OF OPERATOR

Harvey E. Yates Company

3. ADDRESS OF OPERATOR

P.O. Box 1933, Roswell, New Mexico 88202

4. LOCATION OF WELL (Report location clearly and in accordance with any State requirements.
See also space 17 below.)
At surface

990' FNL & 660' FEL, Unit. letter A

5. LEASE DESIGNATION AND SERIAL NO.

NM-53380

6. IF INDIAN, ALLOTTEE OR TRIBE NAME

7. UNIT AGREEMENT NAME

8. FARM OR LEASE NAME

Caviness 10 Federal

9. WELL NO.

4

10. FIELD AND POOL, OR WILDCAT

Mescalero Escarpe Bone Spr.

11. SEC., T., R., M., OR BLK. AND
SURVEY OR AREA

See 10, T18S, R33E

12. COUNTY OR PARISH 13. STATE

Lea

NM

14. PERMIT NO.

30-025-30330

15. ELEVATIONS (Show whether OP, BT, OR, etc.)

4007.6 GL

16. Check Appropriate Box To Indicate Nature of Notice, Report, or Other Data

NOTICE OF INTENTION TO:

TEST WATER SHUT-OFF

FRACURE TREAT

SHOOT OR ACIDIZE

REPAIR WELL

(Other)

PULL OR ALTER CASING

MULTIPLE COMPLETE

ABANDON*

CHANGE PLANS

SUBSEQUENT REPORT OF:

WATER SHUT-OFF

FRACURE TREATMENT

SHOOTING OR ACIDIZING

(Other)

REPAIRING WELL

ALTERING CASING

ABANDONMENT*

(NOTE: Report results of multiple completion on Well
Completion or Recompletion Report and Log form.)

17. DETAILED PROPOSED OR COMPLETED OPERATIONS (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any
proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones perti-
nent to this work.)

PLUGGING PROCEDURE

1. POOH w/ RODS, TBB & ANCHOR.
WAREHOUSE RODS.

2. SET 5 1/2" CIBP @ 8350' PLUS
50' CMT ON TOP.

3. CUT 5 1/2" @ 7,000' + OR - &
PULL CASING.

4. PUMP 170' PLUG (50' IN & 50' OUT)
ACROSS CUT OFF & TAG.

5. PUMP 150' PLUG @ 5114' (TOP OF SAN ANDRES)

6. PUMP 130' PLUG AT 3150' (ACROSS SHOE JT.)

7. PUMP 116' PLUG @ 1588' (TOP OF SALT)

8. PUMP 100' PLUG @ 470' TO 370'.
ACROSS SHOE JT.

9. JO SXS SURFACE PLUG. & INSTALL TORY HOLE MARKER.
CLEAN UP LOCATION.

* Call BLM 24 hours Prior to
Moving In @ 505-887-6544.

** 9-9.5" Mud between Plugs.

Changes per Adam Salernich BLM
Carlsbad 3-2-90
Fixed & Mailed 3-2-90

Called BLM 3-2-90 for Approval. RPL

18. I hereby certify that the foregoing is true and correct

SIGNED

Ray L. Jones by SLS

TITLE Prod. Mgr/Engineer

DATE 12-28-89

(This space for Federal or State office use)

APPROVED BY

CONDITIONS OF APPROVAL, IF ANY:

TITLE

Ray L. Jones

DATE

3-9-90

*See Instructions on Reverse Side