

DEPARTMENT OF THE INTERIOR
BUREAU OF LAND MANAGEMENT

N.M. Oil Cons. Division
1625 N. French Dr.
Hobbs, NM 88240
Bureau No. 1004-0135
Expires: March 31, 1993
Designation and Serial No.

SUNDRY NOTICES AND REPORTS ON WELLS

NM-53381

Do not use this form for proposals to drill or to deepen or reentry to a different reservoir.

Use "APPLICATION FOR PERMIT--" for such proposals

SUBMIT ORIGINAL + 6 COPIES

1. Type of Well ☒ Oil Well ☐ Gas Well ☐ Other

2. Name of Operator
Harvey E. Yates Company

3. Address and Telephone No.
P.O. Box 1933, Roswell, NM 88202 505-623-6601

4. Location of Well (Footage, Sec., T., R., M., or Survey Description)

990' FNL & 330' FWL, Sec 11, T18S, R33E

6. If Indian, Allottee or Tribe Name

7. If Unit or CA, Agreement Designation

8. Well Name and No.

Caviness 11 Fed #3

9. API Well No.

30-025-30634

10. Field and Pool, or Exploratory Area

Mescalero Escarpe Bone Spring

11. County or Parish, State

Lea County, NM

12. CHECK APPROPRIATE BOX (S) TO INDICATE NATURE OF NOTICE, REPORT, OR OTHER DATA

TYPE OF SUBMISSION

☐ Notice of Intent
☒ Subsequent Report
☐ Final Abandonment Notice

TYPE OF ACTION

☐ Abandonment
☐ Recompletion
☐ Plugging Back
☐ Casing Repair
☐ Altering Casing
☒ Other **Plug & Abandon**
☐ Change of Plans
☐ New Construction
☐ Non-Routine Fracturing
☐ Water Shut-Off
☐ Conversion to Injection
☐ Dispose Water
(Note: Report results of multiple completion on Well Completion or Recompletion Report and log form)

13. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work. If wells directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.)*

5/8/01 Set CIBP @ 8,700' w/35' cement on top.
5/9/01 Circ10# mud @ 8,650'. Spot 25 sxs cmt @ 5,718'. Tag @ 5,384'. Load hole back w/mud.
5/10/01 Weld 5 1/2" pull nipple on top of csg. Cut 5 1/2" csg off @ 3,213' and lay down 76 jts.
Circ 10# mud. Spot 35 sxs cmt @ 3,264'.
5/11/01 RIH to tag plug - no plug. Reset 40 sxs cmt @ 3,264'. Tag plug @ 3,090'. Spot 50 sxs cmt @ 554'.
Spot 20 sxs cmt @ 60' to surface. Cut off wellhead. Install dry hole markers. P&A complete.

Handwritten note: If the well is plugged, the wellhead is retained until surface restoration is completed.

14. I hereby certify that the foregoing is true and correct

Signed Dianna Rogers Title Production Analyst Date 15-May-01

(This space for Federal or State office use)

(ORIG. SGD.) DAVID R. GLASS
MAY 24 2001

Approved by _____ Title _____ Date _____
Conditions of approval, if any: _____

DAVID R. GLASS
PETROLEUM ENGINEER

Handwritten: GWW

RECEIVED
2001 MAY 21 AM 9:55
BUREAU OF LAND MGMT
WASHINGTON, DC 20250

