Submit 3 Copies to Appropriate District Office

State of New Mexico Energy, Minerals and Natural Resources Department

Form C-103 Revised 1-1-89

DISTRICT I P.O. Box 1980, Hobbs, NM 88240

OIL CONSERVATION DIVISION P.O. Box 2088

ELL API NO.	
0-025-30756	

DISTRICT II Santa Fe New Mexico 87504_2088	100 020 00100	
DISTRICT II P.O. Drawer DD, Artesia, NM \$8210 DISTRICT III Santa Fe, New Mexico 87504-2088	5. Indicate Type of Lesse STATE X FEE	
1000 Rio Brazos Rd., Aztec, NM 87410	6. State Oil & Gas Lease No. 857948	
SUNDRY NOTICES AND REPORTS ON WELLS		
(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BAC DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)	K TO A 7. Lease Name or Unit Agreement Name VACUUM GRAYBURG SAN ANDRES UNIT	
I. Type of Well: OIL GAS WELL X WELL OTHER		
2. Name of Operator TEXACO PRODUCING INC.	8. Well No. 140	
3. Address of Operator P. O. Box 3109 Midland, Texas 79702	9. Pool same or Wildcat VACUUM GRAYBURG SAN ANDRES	
4. Well Location	TACCOM GRATBONG SAN ANDRES	
Unit Letter H : 1980 Feet From The NORTH Line and	10 Feet From The EAST	
Section 2 Township 18-SOUTH Range 34-EAST	NMPM LEA Count	
GR-4000', KB-4013'	·····	
11. Check Appropriate Box to Indicate Nature of No.	otice Report or Other Data	
NOTICE OF INTENTION TO:	SUBSEQUENT REPORT OF:	
PERFORM REMEDIAL WORK PLUG AND ABANDON REMEDIAL W	ORK ALTERING CASING	
TEMPORARILY ABANDON CHANGE PLANS COMMENCE	DRILLING OPNS. PLUG AND ABANDONMENT	
PULL OR ALTER CASING CASING TEST	CASING TEST AND CEMENT JOB	
OTHER: OTHER: PEF	OTHER: PERFORATE AND TREAT	
12. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dwork) SEE RULE 1103.	dates, including estimated date of starting any proposed	
1. TIH SET RBP AT 4740. TEST WITH 3000#. 2. WEDGE PERF w/ 2 JSPF 4678-82, 4688-91, 4710-15, 4720-24. 33 3. WESTERN ACIDIZED w/ 2200 GAL 28% NEFE WITH 1500# ROCK SALT. 4. RELEASE RBP & PULL UP TO 4670. RESET RBP AND TEST TO 3000#. 5. WEDGE PERF w/ 2 JSPF 4616-19, 4632-34, 4642-48, 4656-61. 33 6. WESTERN ACIDIZED w/ 2200 GAL 28% NEFE. SWAB 4 HOURS REC 81 7. RELEASE RBP & PULL UP TO 4610. RESET RBP AND TEST TO 3000#. 8. WEDGE PERF w/ 2 JSPF 4558-64, 4570-75, 4581-85, 4589-94. 33	SWAB 2 HOURS REC 37 BLW. 2 HOLES. BLW.	
9. WESTERN ACIDIZED w/ 2000 GAL 28% NEFE WITH 1150# OF ROCK SA 10. RELEASE RBP & PULL UP TO 4548. RESET RBP AND TEST TO 3000#. 11. WEDGE PERF w/ 2. ISPE 4478-86. 4498-4501. 4507-10. 4516-18	LLT. SWAB 3 HOURS REC 47 BLW.	

- 12. DOWELL ACIDIZED w/ 2000 GAL 28% NEFE WITH 800# OF ROCK SALT. SWAB 3 HOURS REC 90 BLW.

 13. RELEASE RBP & PULL UP TO 4467. RESET RBP AND TEST TO 3000#.

14. WEDGE PERF w/ 2 JSPF 4378-85, 4397-4400, 4403-06, 4417-20, 4434-46, 4454-57. 62 HOLES. WESTERN ACIDIZED w/3000 GAL 28% NEPE w/ 2000# ROCK SALT. RELEASE RBP. PUT ON PUMP AND TEST.			
I hereby cartify that the information above is true and complete to the best of my knowle	odge and belief. TITLE DRILLING SUPERINTENDENT	DATE 04-13-90	
TYPEOR PRINT NAME C. P. BASHAM		ТЕЛЕРНОМЕ NO. 915-68846 20	
(This space for State Use) ORIGINAL SIGNED BY JERRY SEXTON DISTRICT I SUPERVISOR		APR 1 8 1990	
APPROVED BY	_ mu	DATE	