

Submit 3 Copies
to Appropriate
District Office

State of New Mexico
Energy, Minerals and Natural Resources Department

Form C-103
Revised 1-1-89

DISTRICT I
P.O. Box 1980, Hobbs, NM 88240

DISTRICT II
P.O. Drawer DD, Artesia, NM 88210

DISTRICT III
1000 Rio Brazos Rd., Aztec, NM 87410

OIL CONSERVATION DIVISION
P.O. Box 2088
Santa Fe, New Mexico 87504-2088

WELL API NO. 30-025-30847
5. Indicate Type of Lease STATE <input checked="" type="checkbox"/> FEE <input type="checkbox"/>
6. State Oil & Gas Lease No. 857948
7. Lease Name or Unit Agreement Name VACUUM GRAYBURG SAN ANDRES UNIT
8. Well No. 149
9. Pool name or Wildcat VACUUM GRAYBURG SAN ANDRES

SUNDRY NOTICES AND REPORTS ON WELLS
(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A
DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT"
(FORM C-101) FOR SUCH PROPOSALS.)

1. Type of Well: OIL WELL <input checked="" type="checkbox"/> GAS WELL <input type="checkbox"/> OTHER <input type="checkbox"/>	2. Name of Operator TEXACO PRODUCING INC.	3. Address of Operator P. O. Box 3109 Midland, Texas 79702	4. Well Location Unit Letter <u>C</u> : <u>1330</u> Feet From The <u>NORTH</u> Line and <u>1980</u> Feet From The <u>WEST</u> Line Section <u>1</u> Township <u>18-SOUTH</u> Range <u>34-EAST</u> NMPM LEA County
10. Elevation (Show whether DF, RKB, RT, GR, etc.) GR-3993', KB-4006'			

11. Check Appropriate Box to Indicate Nature of Notice, Report, or Other Data

NOTICE OF INTENTION TO:

PERFORM REMEDIAL WORK ☐ PLUG AND ABANDON ☐
TEMPORARILY ABANDON ☐ CHANGE PLANS ☐
PULL OR ALTER CASING ☐
OTHER: ☐

SUBSEQUENT REPORT OF:

REMEDIAL WORK ☐ ALTERING CASING ☐
COMMENCE DRILLING OPNS. ☐ PLUG AND ABANDONMENT ☐
CASING TEST AND CEMENT JOB ☐
OTHER: COMPLETING ☒

12. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

1. MIRU DA&S. CLEAN OUT TO PBTD OF 4810'. TESTED CASING TO 3000# FOR 30 MINUTES 10-10-90.
2. PENWOOD RAN GR-CCL FROM 4810' TO 4000'. PERF w/ 2 JSPF: 4468-54, 4502-07, 4581-90. 56 HOLES.
3. WESTERN ACIDIZED w/ 4300 GAL 15% NEFE. SWAB 5 BNO, 12 BFW & 89 BLW IN 5 HOURS 10-11-90.
4. TH w/ RBP. SET @ 4440' & TEST TO 3000#. PERF w/ 2 JSPF: 4292-4304, 4360-64, 4376-81, 4411-24. 68 HOLES. WESTERN ACIDIZED w/ 4300 GAL 15% NEFE. SWAB 8 BNO, 54 BFW & 62 BLW IN 6 HOURS 10-13-90.
5. MOVE RBP TO 4275' & TEST TO 3000#. PERF w/ 2 JSPF: 4132-40, 4216-20, 4226-34, 4247-58. 62 HOLES. KNOX ACIDIZED w/ 4300 GAL 15% NEFE. SWAB 5 BNO & 45 BLW IN 8 HOURS 10-16-90. TOH WITH RBP.
6. TH WITH 2 7/8 TUBING AND SUB PUMP. SEATING NIPPLE @ 4708'.
7. PUMP 24 HOURS 10-19-90. RECOVERED 30 BNO, 1000 BFW, & 29 BLW.
8. TESTING. PREP TO POTENTIAL.

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE C. P. Basham/cwt TITLE DRILLING SUPERINTENDENT DATE 10-25-90

TYPE OR PRINT NAME C. P. BASHAM

TELEPHONE NO. 915-6884620

(This space for State Use)

APPROVED BY APPROVED BY JERRY SEXTON

APPROVED BY APPROVED BY TITLE APPROVED BY DATE APPROVED BY

CONDITIONS OF APPROVAL, IF ANY: