

Harvey E. Yates Company
Buckeye 12 State #1
1980' FNL & 1980' FWL
Sec. 12, T18S, R35E
Lea Co., New Mexico

5/15/91 Drill out CIBP @ 10,510'; Set CIBP @ 10,530'; Set
retainer @ 10,500'; Sqz perfs @ 10,520-24'; Kick off
flowing
5/30/91 Re-sqz perfs 10,520-24'; Drill out to 10,500'
6/2/91 Perf 10,460' w/4 holes; Acdz w/500 gals 10% NEFE; Kick
off flowing
6/19/91 Set pkr & cavity @ 8965'; Put on jet pmp
7/6/91 Set retainer @ 10,400'; Sqz perfs 10,460-72'; Drill out
to 10,500'
7/13/91 Abraza jet 10 holes @ 10,459'; Acdz w/750 gals 20%
MSR-100; Swab test
7/17/91 Set CIBP @ 10,400'; Perf 10,140-56'; Acdz w/1000 gals
20% NEFE; Swab test
7/21/91 Set retainer @ 10,120'; Sqz perfs 10,140-56'
7/23/91 Perf 10,050-58' & 10,067-74'; Acdz w/1800 gals 20% NEFE;
Swab test
7/26/91 Set retainer @ 9938-44'; Sqz perfs 10,050-58' &
10,067-74'; Perf 9938-44'; Acdz w/3500 gals 20% NEFE;
Swab test
8/1/91 Acdz perfs 9938-44' w/3000 gals 20% gelled 20% NEFE &
3000 gals overflush; Swab test
8/6/91 Set retainer @ 9878'; Sqz perfs 9938-44'; Perf 9652-68';
Acdz w/1800 gals; Swab test
8/9/91 Set retainer @ 9607'; Sqz perfs 9652-68'; Perf 9440-70';
Acdz w/2000 gals 20% NEFE; Swab test
8/13/91 Acdz perfs 9440-70' w/5000 gals 20% NEFE w/2% HF; Swab
test
8/16/91 Set retainer @ 9381'; Sqz perfs 9440-70'; Perf 8520-26 &
8536-44'; Acdz w/2000 gals 20% NEFE; Swab test
8/17/91 Acdz perfs 8520-44' w/6000 gals 20% NEFE & 3000 gals
overflush; Swab test
8/20/91 Set CIBP @ 8500'; Perf 8084-96'; Acdz w/5000 gals 15%
SRA; Swab test
8/30/91 Acdz perfs 8084-96' w/10,000 gals 20% NEFE & 10,000 gals
overflush; Swab testing

sund.buc