

OIL CONSERVATION DIVISION

P. O. Box 2088

Santa Fe, New Mexico 87504-2088

**DISTRICT I**

P. O. Box 1980 Hobbs, NM 88240

**DISTRICT II**

P. O. Drawer DD, Artesia, NM 88210

**DISTRICT III**

1000 Rio Brazos Rd, Aztec, NM 87410

Well APINO.	30-025-32234
5. Indicate Type or Lease	STATE <input type="checkbox"/> FEE <input checked="" type="checkbox"/>
6. State Oil & Gas Lease No.	
7. Lease Name or Unit Agreement Name SANTA FE EXPLORATION	
8. Well No.	2
9. Pool name or Wildcat	S. Corbin <input checked="" type="checkbox"/> UNDESIGNATED WILDCAT

**SUNDRY NOTICES AND REPORTS ON WELLS**

(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A  
DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT"  
(FORM C-101) FOR SUCH PROPOSALS.)

1. Type of Well OIL <input type="checkbox"/> GAS <input type="checkbox"/> WELL <input type="checkbox"/> WELL <input type="checkbox"/> OTHER <input type="checkbox"/>	2. Name of Operator Harvey E. Yates Company
3. Address of Operator P.O. Box 1993, Roswell, NM 88202 1-505-623-6601	4. Well Location Unit Letter I : 1,980 Feet From The SOUTH Line and 660 Feet From The EAST Line Section 6 Township 18-S Range 33-E NMPM LEA County
10. Elevation (Show whether DF, RKB, RT, GR, etc.) 3964.9' GR	

11. Check Appropriate Box to Indicate Nature of Notice, Report, or Other Data	
NOTICE OF INTENTION TO: PERFORM REMEDIAL WORK <input type="checkbox"/> TEMPORARILY ABANDON <input type="checkbox"/> PULL OR ALTER CASING <input type="checkbox"/> OTHER: <input type="checkbox"/>	SUBSEQUENT REPORT OF: REMEDIAL WORK <input type="checkbox"/> COMMENCE DRILLING OPNS. <input type="checkbox"/> CASING TEST AND CEMENT JOB <input type="checkbox"/> OTHER: UPDATE ON ACTIVITY 1-21-94 TO 3-10-94 <input checked="" type="checkbox"/>

12. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work.) SEE RULE 1103

2-3-94 PUMP JET PUMP OUT OF HOLE. POOH w/ TBG. & PKR.  
2-4-94 RUN PUMP IN TRACER (DELAWARE PERFS 6448-60') = NO CHANNEL.  
2-9-94 SET CIBP @ 6400'. PERFORATE DELAWARE 5522-43 (OA). ACDZ w/ 200 GALS 10% NEFE.  
FOLLOW w/ 1300 GALS SAME & RCN BS. SWAB TO TEST.  
2-12-94 FRAC DELAWARE PERFS w/ 5700 GALS 30# X-LINK & 9275# SD.  
2-15-94 GIH w/ PKR, CAVITY AND TBG TO 5340'. SET PKR, & TEST. PUMP JET PUMP TO BOTTOM.  
PUT WELL ON PROD. @ 1PM.  
3-9-94 POOH WITH DOWN HOLE EQUIPMENT.  
3-10-94 GIH w/ TBG, TAC, AND REMAINING TBG. SET TAC @ 5334' w/ SN @ 5567'.  
RIH w/ PUMP & RODS. PUT ON PROD.  
TESTING WELL ON ROD PUMP.

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE	TITLE	PROD. MGR. / ENGINEER	Date	3/31/94
TYPE OR PRINT NAME	RAY F. NOKES	TELEPHONE NO.	1-505-623-6601	

(This space for State use)

Approved by	ORIGINAL SIGNED BY JERRY BENYON	Date	APR 05 1994
Conditions of approval, if any:	DISTRICT I SUPERVISOR		