

DISTRICT I

P.O. Box 1980, Hobbs, NM 88240

DISTRICT II

P.O. Box Drawer DD, Artesia, NM 88210

DISTRICT III

1000 Rio Brazos Rd., Aztec, NM 87410

OIL CONSERVATION DIVISION

P.O. Box 2088

Santa Fe, New Mexico 87504-2088

WELL API NO.	30-025-32801
5. Indicate Type of Lease	STATE ☒ FEE ☐
6. State Oil / Gas Lease No.	B-1113-1
7. Lease Name or Unit Agreement Name	CENTRAL VACUUM UNIT
8. Well No.	194
9. Pool Name or Wildcat	VACUUM GRAYBURG SAN ANDRES
10. Elevation (Show whether DF, RKB, RT, GR, etc.)	3979' GR

SUNDRY NOTICES AND REPORTS ON WELLS
(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO
DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMI
(FORM C-101) FOR SUCH PROPOSALS.

1. Type of Well:	OIL WELL ☐ GAS WELL ☐ OTHER INJECTION ☐
2. Name of Operator	TEXACO EXPLORATION & PRODUCTION INC.
3. Address of Operator	205 E. Bender, HOBBS, NM 88240
4. Well Location	Unit Letter C : 14 Feet From The NORTH Line and 1917 Feet From The WEST Line Section 6 Township 18-S Range 35-E NMPM LEA COUNTY
10. Elevation (Show whether DF, RKB, RT, GR, etc.)	3979' GR

11. Check Appropriate Box to Indicate Nature of Notice, Report, or Other Data

NOTICE OF INTENTION TO:

PERFORM REMEDIAL WORK ☐ PLUG AND ABANDON ☐
TEMPORARILY ABANDON ☐ CHANGE PLANS ☐
PULL OR ALTER CASING ☐
OTHER: ☐

SUBSEQUENT REPORT OF:

REMEDIAL WORK ☒ ALTERING CASING ☐
COMMENCE DRILLING OPERATION ☐ PLUG AND ABANDONMENT ☐
CASING TEST AND CEMENT JOB ☐
OTHER: ☒ WW (CO2)

12. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

4-21-00: MIRU. RU REV UNHIT. INSTL LO/TO. SET BLOW DN TANK. KILL W/500 BBLs 10# BRINE. NDWH. NU HYDR BOP. TEST BOP.
4-24-00: ATTEMPT TO REL PKR. WORK FREE. TIH W/BIT & CSG SCRAPER TO 4021'.
4-25-00: TIH TO 4664. TAG UP BTM PERF @ 4689'. TIH W/RBP & PKR & TBG. SET RBP @ 4208'. DISPL W/10# BRINE. SET PKR @ 4185'. TEST RBP TO 1000 PSI. NDBOP. CHANGE OUT CSG VALVES. NUBOP. PSI TEST CSG TO 4185 TO SURF.
4-26-00: REL PKR @ 4185'. TIH W/PKR TO 4185'. ATTEMPT TO TEST RBP-NO TEST.
4-27-00: TIH W/RETR TOOL, & TBG. TAG @ 4204'. WASH 4204-4 208. FISH RBP. MOVE & SET @ 4177'. TEST CHART CSG 4177-SURF TO 900 PSI-30 MIN-OK. LATCH/REL RBP. TIH W/CONE BUSTER MILL, DC'S & TBG TO 4186'.
4-28-00: TIH TO 4196'. WSH/CLN OUT SCALE TO 4701'. PERFS 4208-4686'. TIH W/PKR, SN, & TBG. PSA 4180'. PSI CSG TO 950 PSI-OK.
5-01-00: ACIDIZE PERFS 4281-4686 W/8000 GALS 15% NEFE. FLOW WELL TO FRAC TANK.
5-02-00: FLOW 5 HRS. KILL W/10# BRINE. REL PKR. TIH W/BIT & TAG @ PBD OF 4701'.
5-03-00: RUN PUMP OUT PLUG, GVI PKR, 2 7/8" TBG, SUB. PSA 4208'. REL ON/OFF TOOL. TEST CHART TO 620 PSI. NDBOP. INSTL CO2 TREE. RIG DOWN.
5-15-00: ON 24 HR OPT. WIW (CO2) 2248 MCFPD @ 1754 PSI.
FINAL REPORT

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE J. Denise Leake TITLE Engineering Assistant

DATE 7/11/00

TYPE OR PRINT NAME J. Denise Leake

Telephone No. 397-0405

(This space for State Use)

APPROVED

CONDITIONS OF APPROVAL IF ANY: TITLE

DATE

DeSoto/Nichols 12-93 ver 1.0

JCS





