

Submit 3 Copies
to Appropriate
District Office

State of New Mexico
Energy, Minerals and Natural Resources Department

Form C-103
Revised 1-1-89

DISTRICT I
P.O. Box 1940, Hobbs, NM 88240

DISTRICT II
P.O. Drawer DO, Artesia, NM 88210

DISTRICT III
1000 Rio Brazos Rd., Aztec, NM 87410

OIL CONSERVATION DIVISION
P.O. Box 2088
Santa Fe, New Mexico 87504-2088

WELL API NO. 30-025-34343
5. Indicate Type of Lease STATE ☒ FEE ☐
6. State Oil & Gas Lease No. 22993
7. Lease Name or Unit Agreement Name West Hobbs State Unit
8. Well No. 1
9. Pool name or Wildcat Wildcat/Abo

SUNDRY NOTICES AND REPORTS ON WELLS (DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)	
1. Type of Well: OIL WELL ☐ GAS WELL ☐ OTHER Dry	
2. Name of Operator Ricks Exploration, Inc.	
3. Address of Operator 210 Park Avenue, Ste. 3000, Oklahoma City, OK 73102	
4. Well Location Unit Letter P : 1120 Feet From The South Line and 860 Feet From The East Line Section 8 Township 18S Range 37E NMPM Lea County	
10. Elevation (Show whether DF, RKB, RT, GR, etc.) GL 3741' KB 3784'	

11. Check Appropriate Box to Indicate Nature of Notice, Report, or Other Data	
NOTICE OF INTENTION TO:	SUBSEQUENT REPORT OF:
PERFORM REMEDIAL WORK ☐	REMEDIAL WORK ☐
TEMPORARILY ABANDON ☐	ALTERING CASING ☐
PULL OR ALTER CASING ☐	COMMENCE DRILLING OPNS. ☐
OTHER: ☐	PLUG AND ABANDONMENT ☒
	CASING TEST AND CEMENT JOB ☐
	OTHER: ☐

12. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

11-31-00 Inform OCD of intent to move in & commence plugging.

12-01-00 RIH w/ tbg. to 4084'. Spot 25 sx, tag cmt. @ 3870', mix 30 sx salt gel.

12-04-00 Cut 5-1/2" csg. @ 3155', POOH w/ csg. RIH w/ tbg. to 3205'. Spot 50 sx cmt. POOH w/ tbg. Shut well in.

12-05-00 RIH w/ tbg. tag plug @ 3150'. TOC. Spot 50 sx @ 3150'. RIH to tag plug, plug not there. Spot 50 sx @ 3150', POOH.

12-06-00 RIH to tag plug. Plug not there. Spot 100 sx, POOH, RIH to tag plug. Plug not there. Spot 200 sx. POOH.

12-07-00 RIH, tag TOC @ 2550'. Pull tbg. to 1800'. Spot 35 sx. Pull tbg. to 425'. Mix 15 sx salt gel. Pull tbg. to 425'. Spot 35 sx WOC & tag cmt. @ 290'. POOH w/ tbg. Put one jt. in hole. Spot 10 sx. Surface plug.

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE Roger Massey TITLE Agent DATE 12/31/00
TYPE OR PRINT NAME Roger Massey TELEPHONE NO. (915) 530-0907

(This space for State Use)

APPROVED BY Johnny Robinson TITLE DATE AUG 24 2001
CONDITIONS OF APPROVAL, IF ANY: