

4-02-00: TIH W/PKR & SET @ 6020.
4-04-00: MAKE 18 SWAB RUNS. SET RBP @ 6450. PSA 6420. TEWST RBP TO 1000 PSI. TEST PKR TO 1000 PSI.
4-05-00: UNSEAT PKR. TAG TOP OF SAND @ 6580. PULL UP & SET PKR @ 6444.
4-07-00: TIH W/CATCH TOOL & RETR RBO @ 6564'. TIH W/15 STDS KILL STRING.
4-08-00: PSA 5511 ON TBG.
4-09-00: PUMP 289 SX OF 400 SX. REVERSED 132 SX TO PIT. SQZD BLINEBRY PERFS 6068-6498 W/157 SX. REL PKR. PSA 5261.
4-11-00: REL PKR. TAG CMT @ 5538. DRLD CMT 5538-5813. REV CIRC 400 PSI.
4-12-00: DRLD CMT 5813-6310.
4-13-00: DRLD CMT 6310-6459. TIH W/2 JTS. TAG FILL ON RBP @ 6542. PU RET PKR. & SET @ 6453'.
4-14-00: MVE PKR UP HLE TO 6448. SN @ 6440.
4-15-00: UNSEAT PKR @ 6448. WASH OUT 8' SD TO 6590.
4-16-00: SET BP @ 6101. DUMP 25' SD ON BP. REPERF TOP OF BLINEBRY 6068-6094. SET PKR @ 6012.
4-18/4-20-00: SWAB
4-21-00: TEST LINES TO 2500 PSI.
4-26-00: PU RETR TOOL W/SLIPS. REV CIRC 2' SAND OFF RBP @ 6102. REL RBP @ 6102.
4-27-00: PU PROD STRING 2 7/8" 6.50# L-80 EUE. TBG ANCHOR @ 6670. NDBOP. NUWH.
4-28-00: INSTL RDS & PMP, 1 3/4"X24' PUMP, K-BARS. RIG DOWN.
4-30/5-7-00: PUMP TEST ---W/O OPT.