State of New Mexico Energy, Minerals and Natural Resources Department

Form C-103 Revised 1-1-89

P.O. Box 1980, Hobbs, NM 88240		TION DIVISION	WELL API NO.	
	P.O. Box 2088		30-025-02098	
ISTRICT II Santa Fe, New Mexico 87504-2088 O. Drawer DD, Artesia, NM 88210		5. Indicate Type of Lease		
DISTRICT III			STATE X FEE	
1000 Rio Brazos Rd., Aztec, NM 87410			6. State Oil & Gas Lease No. NA	
SUNDRY NOTICE	S AND REPORTS ON	WELLS		
(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)			7. Lease Name or Unit Agreement Name STATE G	
i. Type of Well:		· · · · · · · · · · · · · · · · · · ·		
ART AR ART CON	OTHER IN	dertis se		
2. Name of Operator)		8. Well No.	
Mobil Producing Tx. & N.M. Inc.*			3	
3. Address of Operator *Mobil Exploration & Producing U.S. Inc., as Agent for			9. Pool name or Wildcat	
Mobil Producing TX. & N.M. Inc., P. O. Box 633, Midland, TX 79702			VACUUM (GRAYBURG/SAN ANDRES)	
4. Well Location	Name la			
Unit Letter G : 1900	Feet From The NOTEN	Line and	Feet From The East Line	
Section 24	Township 17S	Range 34E	NMPM LEA County	
	10. Elevation (Show wh	ether DF, RKB, RT, GR, etc.)		
	//// NA			
11. Check Ap	propriate Box to Indica	ate Nature of Notice, R	leport, or Other Data	
NOTICE OF INTE	NTION TO:	SUE	SSEQUENT REPORT OF:	
DEDECORA DEMEDIAL MODIL	51115 4115 454115GH	,		
PERFORM REMEDIAL WORK	PLUG AND ABANDON	X REMEDIAL WORK	ALTERING CASING	
TEMPORARILY ABANDON	CHANGE PLANS	COMMENCE DRILLING	COMMENCE DRILLING OPNS. PLUG AND ABANDONMENT	
LL OR ALTER CASING CASING TEST AND C		EMENT JOB		
OTHER:	[OTHER:		
12. Describe Proposed or Completed Operation work) SEE RULE 1103.	s (Clearly state all pertinent deta	ils, and give pertinent dates, inclu	iding estimated date of starting any proposed	
	#1 DOD - M1 34/C			
10 876 FT. 5. SPOT PLUG OF 46 SX CMT 876 6. SPOT 21 SX 50 TO SURFACE.	ND PULL CSG. 50-2230. PU TBG TO 1: 50-1633 ACROSS TOP @ 6-765. PU TBG TO 50 F POH W/WS. WOC. I BELOW GD LEVEL. WI	₹ 1700. PU TBG & WOC. FT. ELD STEEL PLATE ON C	. TAB CMT PLUG TOP @ 1633. PU TBG SG STUB. ERECT P&A MARKER W/	
2. RiH W/CSG & JACKET. CUT AN 3. SPOT PLUG OF 36 SX CMT 23: 4. SPOT PLUG OF 47 SX CMT 17: TO 876 FT. 5. SPOT PLUG OF 46 SX CMT 876 6. SPOT 21 SX 50 TO SURFACE. 7. ND BOP. RD PU. CUT CSG 3 FT	ND PULL CSG. 50-2230. PU TBG TO 1: 50-1633 ACROSS TOP @ 6-765. PU TBG TO 50 F POH W/WS. WOC. I BELOW GD LEVEL. WI	₹ 1700. PU TBG & WOC. FT. ELD STEEL PLATE ON C		
2. Rih W/CSG & JACKET. CUT AN 3. SPOT PLUG OF 36 SX CMT 23: 4. SPOT PLUG OF 47 SX CMT 17: TO 876 FT. 5. SPOT PLUG OF 46 SX CMT 87: 6. SPOT 21 SX 50 TO SURFACE. 7. ND BOP. RD PU. CUT CSG 3 FT	ND PULL CSG. 50-2230. PU TBG TO 1: 50-1633 ACROSS TOP @ 6-765. PU TBG TO 50 F POH W/WS. WOC. T BELOW GD LEVEL. WE L CELLAR AND CLEAN S	9 1700. PU TBG & WOC. FT. ELD STEEL PLATE ON C SURFACE LOCATION.		
2. RiH W/CSG & JACKET. CUT AN 3. SPOT PLUG OF 36 SX CMT 23: 4. SPOT PLUG OF 47 SX CMT 17: TO 876 FT. 5. SPOT PLUG OF 46 SX CMT 87: 6. SPOT 21 SX 50 TO SURFACE. 7. ND BOP. RD PU. CUT CSG 3 FT WELL NAME AND PLUG DATE. FIL	ND PULL CSG. 50-2230. PU TBG TO 1: 50-1633 ACROSS TOP @ 6-765. PU TBG TO 50 F POH W/WS. WOC. T BELOW GD LEVEL. WE L CELLAR AND CLEAN S	9 1700. PU TBG & WOC. FT. ELD STEEL PLATE ON C SURFACE LOCATION.		
2. RIH W/CSG & JACKET. CUT AN 3. SPOT PLUG OF 36 SX CMT 23: 4. SPOT PLUG OF 47 SX CMT 17: TO 876 FT. 5. SPOT PLUG OF 46 SX CMT 87: 6. SPOT 21 SX 50 TO SURFACE. 7. ND BOP. RD PU. CUT CSG 3 FT WELL NAME AND PLUG DATE. FIL	ND PULL CSG. 50-2230. PU TBG TO 1: 50-1633 ACROSS TOP @ 6-765. PU TBG TO 50 F POH W/WS. WOC. I BELOW GD LEVEL. WE L CELLAR AND CLEAN S	9 1700. PU TBG & WOC. FT. ELD STEEL PLATE ON C SURFACE LOCATION. CD 6/12/91.		
2. RIH W/CSG & JACKET. CUT AN 3. SPOT PLUG OF 36 SX CMT 23: 4. SPOT PLUG OF 47 SX CMT 17: TO 876 FT. 5. SPOT PLUG OF 46 SX CMT 87: 6. SPOT 21 SX 50 TO SURFACE. 7. ND BOP. RD PU. CUT CSG 3 FT WELL NAME AND PLUG DATE. FIL VERBAL APPROVAL OBTAINED FRO I hereby 'certify that/the information above is true any	ND PULL CSG. 50-2230. PU TBG TO 1: 50-1633 ACROSS TOP @ 6-765. PU TBG TO 50 F POH W/WS. WOC. I BELOW GD LEVEL. WE L CELLAR AND CLEAN S	9 1700. PU TBG & WOC. FT. ELD STEEL PLATE ON C SURFACE LOCATION. CD 6/12/91.	SG STUB. ERECT P&A MARKER W/	
2. RIH W/CSG & JACKET. CUT AN 3. SPOT PLUG OF 36 SX CMT 23: 4. SPOT PLUG OF 47 SX CMT 17: TO 876 FT. 5. SPOT PLUG OF 46 SX CMT 87: 6. SPOT 21 SX 50 TO SURFACE. 7. ND BOP. RD PU. CUT CSG 3 FT WELL NAME AND PLUG DATE. FIL	ND PULL CSG. 50-2230. PU TBG TO 1: 50-1633 ACROSS TOP @ 6-765. PU TBG TO 50 F POH W/WS. WOC. I BELOW GD LEVEL. WE L CELLAR AND CLEAN S	9 1700. PU TBG & WOC. FT. ELD STEEL PLATE ON C SURFACE LOCATION. CD 6/12/91. ge and belief.	SG STUB. ERECT P&A MARKER W/	

CONDITIONS OF APPROVAL, IF ANY: