

Submit 3 Copies
to Appropriate
District Office

State of New Mexico
Energy, Minerals and Natural Resources Department

Form C-103
Revised 1-1-89

DISTRICT I
P.O. Box 1980, Hobbs, NM 88240

DISTRICT II
P.O. Drawer DD, Artesia, NM 88210

DISTRICT III
1000 Rio Brazos Rd., Aztec, NM 87410

OIL CONSERVATION DIVISION
P.O. Box 2088
Santa Fe, New Mexico 87504-2088

WELL API NO. 30-025-02106
5. Indicate Type of Lease STATE ☒ FEE ☐
6. State Oil & Gas Lease No.
7. Lease Name or Unit Agreement Name BRIDGES STATE
8. Well No. 36
9. Pool name or Wildcat VACUUM GLORIETA
10. Elevation (Show whether DF, RKB, RT, GR, etc.)

SUNDRY NOTICES AND REPORTS ON WELLS (DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)	
1. Type of Well: OIL WELL ☒ GAS WELL ☐ OTHER	
2. Name of Operator Mobil Producing Tx. & N.M. Inc.*	
3. Address of Operator *Mobil Exploration & Producing U.S. Inc., as Agent for Mobil Producing TX. & N.M. Inc., P. O. Box 633, Midland, TX 79702	
4. Well Location Unit Letter <u>D</u> : <u>660</u> Feet From The <u>NORTH</u> Line and <u>660</u> Feet From The <u>WEST</u> Line Section <u>25</u> Township <u>17S</u> Range <u>34E</u> NMPM LEA County	
10. Elevation (Show whether DF, RKB, RT, GR, etc.)	

11. Check Appropriate Box to Indicate Nature of Notice, Report, or Other Data

NOTICE OF INTENTION TO:

PERFORM REMEDIAL WORK ☐ PLUG AND ABANDON ☐
TEMPORARILY ABANDON ☐ CHANGE PLANS ☐
PULL OR ALTER CASING ☐
OTHER: ☐

SUBSEQUENT REPORT OF:

REMEDIAL WORK ☐ ALTERING CASING ☐
COMMENCE DRILLING OPNS. ☐ PLUG AND ABANDONMENT ☐
CASING TEST AND CEMENT JOB ☐
OTHER: DRILL DEEPER ☒

12. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

12-29 MIRU PRIDE WS #222
12-30 RIH W/BIT TO 4353, TOP OF 5: CIBP; PRESS TEST CSG 500# 15 MIN OK. DRL CIBP; CIRC & CLEAN, POH W/TBG
12-31 RIH TO 4353. DRL CIBP, FELL THRU, CIRC, CLEAN. RIH TO 4818, POH. RIH W/5 IN RTTS & SN + TBG TO 4367 &
SET; PUMP INTO SA PERFS 4448-4526 @ .75 BPM @2000#. POH W/RTTS; RIH W/CMT RET & TBG TO 3680
01-01 RIH W/ADD TBG TO 4336, SET RET. RU HOWCO; SQZ SA PERFS W/75 SX CL C +2% CALCLZ. SQZ OFF @
3000# W/6 BBL. PO RTR & REV OUT 8 BBL OF CMT. POH W/TOOLS
01-02 RIH W/TBG TO 4336; RU POWER SWIVEL; DRL OUT CMT 4336-4418
01-03 DRL CMT 4418-4526 FELL THRU. RUN TO 4600. CIRC & PRESS TEST TO 500# OK. DRIL CIBP 4857-58 CIRC
01-04 RIH TO 4858. DRL ON CIBP 4858-4860, FELL THRU. RIH TO 4940. DRL CIBP 4940-4950. REC CAST IRON, GYP,
IRON SUL, SCALE
01-05 POH W/BIT, ND BOP, NU BOP; RIH TO 4950, DRL 4950-4952. REC CAST IRON, METAL. RD SWIVEL POH W/TBG
01-06 POH W/BIT; RIH W/CUT SHOE + TBG, TAG @4952. WASH 4952-CIBP. REC METAL, RUBBER, WOOD, SCALE.
CUT OVER CIBP, FELL THRU. RIH TO 5085. CIRC & CLEAN. TEST CSG TO 500# OK 15 MIN. PULL TBG & SHOE
01-07 RIH W/SHOE & WP. PUSH CIBP TO 6329 PBTD. CIRC CLN. POH. JUNK IN WP: MUD ANCHOR, OTHER. RIH W/OS,
GRAP, JAR, & DCW ON TBG TO 6329. POH W/5 STDS TBG
~~01-08 Circ WELL W/CLEAN WIR, TEST TO 320#. POH W/TBG, DC&OS. ND BOP, NU WELLHEAD W/4 FT SUB. RD, REL TO TEXACO~~

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE Kaye Pollock TITLE REGULATORY TECHN DATE 01-21-93
TYPE OR PRINT NAME KAYE POLLOCK (915)
TELEPHONE NO. 688-2584

(This space for State Use)

Orig. Sig
Paul K...
Geologist

APPROVED BY _____ TITLE _____ DATE JAN 27 1993

CONDITIONS OF APPROVAL, IF ANY: