

DISTRICT I
P.O. Box 1980, Hobbs, NM 88240

DISTRICT II
P.O. Drawer DD, Artesia, NM 88210

DISTRICT III
1000 Rio Brazos Rd., Aztec, NM 87410

OIL CONSERVATION DIVISION
P.O. Box 2088
Santa Fe, New Mexico 87504-2088

WELL API NO. 3002502138
5. Indicate Type of Lease STATE ☒ FEE ☐
6. State Oil & Gas Lease No. 011126
7. Lease Name or Unit Agreement Name West Vacuum Unit
8. Well No. 3
9. Pool name or Wildcat Vacuum <i>CB SA</i>

SUNDRY NOTICES AND REPORTS ON WELLS
(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)

1. Type of Well: OIL WELL ☒ GAS WELL ☐ OTHER ☐	2. Name of Operator Texaco E&P Inc.
3. Address of Operator P.O. Box 3109 Midland, Tx 79702	4. Well Location Unit Letter <u>L</u> : 1980 Feet From The <u>South</u> Line and <u>660</u> Feet From The <u>West</u> Line Section <u>28</u> Township <u>17S</u> Range <u>34E</u> NMPM <u>Lea</u> County <u></u>
10. Elevation (Show whether DF, RKB, RT, CR, etc.)	

11. Check Appropriate Box to Indicate Nature of Notice, Report, or Other Data.

NOTICE OF INTENTION TO:		SUBSEQUENT REPORT OF:	
PERFORM REMEDIAL WORK ☐	PLUG AND ABANDON ☐	REMEDIAL WORK ☐	ALTERING CASING ☐
TEMPORARILY ABANDON ☐	CHANGE PLANS ☐	COMMENCE DRILLING OPNS. ☐	PLUG AND ABANDONMENT ☒
PULL OR ALTER CASING ☐		CASING TEST AND CEMENT JOB ☐	
OTHER: ☐		OTHER: ☐	

12. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

3-23-95 Notify NMOCD of intent to plug & abandon well. Talked to Buddy Hill.

3-24-95 Set 5½" cmt. ret. @ 4500'. Sqz 130sx cmt. below shut in @ 1800 PSI Cap CICR w/20sx cmt. cal TOC = 4303'.

3-24-95 Spot 25sx cmt. tag TOC 3707-3900.

3-27-95 Perf. 2900' set cmt. ret 2750' Sqz. 130sx below shut in @ 1400PSI. Cap cmt. ret. w/ 20sx cmt. cal TOC @ 2553'.

3-27-95 Perf. 1800' set cmt. ret. @ 1700' Sqz. 130sx cmt. below. Shut in @ 700PSI Cap cmt. ret. w/20sx cmt. cal TOC 1503'.

3-27-95 Perf. @ 500 Circ. 150sx cmt. down 5½" thru perfs @ 500' cmt. to surf. up 5½" x 8-5/8" ann. Left 5½" csg. full out cmt. f/500'-surface.

3-28-95 Dig out cellar cut off head; cap well & install dryhole marker. Clean up location; rig down & move.

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE [Signature] TITLE P&A Supervisor DATE 3-28-95

TYPE OR PRINT NAME J. Calder TELEPHONE NO.

(This space for State Use)

APPROVED BY [Signature] TITLE OIL & GAS INSPECTOR DATE MAY 16 1995

CONDITIONS OF APPROVAL, IF ANY:

Top