

to A, appropriate
District Office

Energy, Minerals and Natural Resources Department

Form C-100
Revised 1-1-89

DISTRICT I
P.O. Box 1980, Hobbs, NM 88240

OIL CONSERVATION DIVISION

DISTRICT II
P.O. Drawer DD, Artesia, NM 88210

P.O. Box 2088

Santa Fe, New Mexico 87504-2088

DISTRICT III
1000 Rio Brazos Rd., Aztec, NM 87410

WELL API NO.	3002502139
5. Indicate Type of Lease	STATE ☒ FEE ☐
6. State Oil & Gas Lease No.	011126
7. Lease Name or Unit Agreement Name	
West Vacuum Unit	
8. Well No.	1
9. Pool name or Wildcat	Vacuum <i>EB/SA</i>
10. Elevation (Show whether DF, RKB, RT, GR, etc.)	
4071 GR	

SUNDRY NOTICES AND REPORTS ON WELLS
(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A
DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT"
(FORM C-101) FOR SUCH PROPOSALS.)

1. Type of Well: OIL WELL ☒ GAS WELL ☐ OTHER ☐	2. Name of Operator Texaco E&P Inc
3. Address of Operator P.O. Box 3109 Midland Texas 79702	4. Well Location Unit Letter <u>E</u> : <u>2310</u> Feet From The <u>North</u> Line and <u>330</u> Feet From The <u>West</u> Line Section <u>28</u> Township <u>17S</u> Range <u>34E</u> NMPM LEA County
10. Elevation (Show whether DF, RKB, RT, GR, etc.) 4071 GR	

11. Check Appropriate Box to Indicate Nature of Notice, Report, or Other Data.	
NOTICE OF INTENTION TO:	SUBSEQUENT REPORT OF:
PERFORM REMEDIAL WORK ☐	PLUG AND ABANDON ☐
TEMPORARILY ABANDON ☐	CHANGE PLANS ☐
PULL OR ALTER CASING ☐	OTHER: ☐
12. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.	

- 1) 3-17-95 Notify NMOCDD of intent to Plug & Abandon well
- 2) 3-20-95 Squeeze down 3 1/2" csg w/150sx cmt displaced to 4400'
- 3) Tag TOC 3-21-95 @4252' (perf 4534-4732)
- 5) 3-21-95 Spot 25sx cmt plug from 3900-3358 WOC & Tag @ 3358.
- 6) 3-21-95 POOH to 2900' spot 25sx cmt plug f/2900-2223 WOC & Tag 3-22-95 @ 2223'
- 7) 3-22-95 POOH to 1800' Spot 25sx cmt plug f/1800- @1130
- 8) POOH to 450' Spot 25sx cmt Plug F/450-surface.
- 9) Dig out cellar & Cut off well head cap well; install dry hole marker; rig down unit and move.

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE <u>[Signature]</u>	TITLE <u>P&A Supervisor</u>	DATE <u>3-22-95</u>
TYPE OR PRINT NAME <u>J. Calder</u>		TELEPHONE NO. <u>915-563-2805</u>

(This space for State Use)

APPROVED BY [Signature] TITLE OIL & GAS INSPECTOR DATE MAY 08 1995

CONDITIONS OF APPROVAL, IF ANY:

JC

Up

RECEIVED

100 03 1805

**OCD HOBBS
OFFICE**