

Submit 5 Copies
to Appropriate
District Office

State of New Mexico
Energy, Minerals and Natural Resources Department

1
R -89

DISTRICT I
P.O. Box 1980, Hobbs, NM 88240

DISTRICT II
P.O. Drawer DD, Artesia, NM 88210

DISTRICT III
1000 Rio Brazos Rd., Aztec, NM 87410

OIL CONSERVATION DIVISION
P.O. Box 2088
Santa Fe, New Mexico 87504-2088

WELL API NO. 3002502139
5. Indicate Type of Lease STATE ☒ FEE ☐
6. State Oil & Gas Lease No. 011126
7. Lease Name or Unit Agreement Name West Vacuum Unit
8. Well No. 1
9. Pool name or Wildcat Vacuum <u>GB/SA</u>
10. Elevation (Show whether DF, RKB, RT, GR, etc.)

SUNDRY NOTICES AND REPORTS ON WELLS
(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)

1. Type of Well: OIL WELL ☒ GAS WELL ☐ OTHER	2. Name of Operator Texaco E&P Inc.
3. Address of Operator P.O. Box 3109 Midland, TX 79702	4. Well Location Unit Letter <u>E</u> : 2310 Feet From The <u>North</u> Line and <u>330</u> Feet From The <u>West</u> Line Section <u>28</u> Township <u>17S</u> Range <u>34E</u> NMPM Lea County

11. Check Appropriate Box to Indicate Nature of Notice, Report, or Other Data.	
NOTICE OF INTENTION TO:	SUBSEQUENT REPORT OF:
PERFORM REMEDIAL WORK ☒	PLUG AND ABANDON ☒
TEMPORARILY ABANDON ☐	REMEDIAL WORK ☐
PULL OR ALTER CASING ☐	ALTERING CASING ☐
OTHER: ☐	COMMENCE DRILLING OPNS. ☐
	PLUG AND ABANDONMENT ☐
	CASING TEST AND CEMENT JOB ☐
	OTHER: ☐

12. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

1. Notify NMOCD of intent to plug & abandon well prior to moving on well.
2. Est. injection rate SQ 150 sxs class C cmt into perf. 4534-4732 displace cmt to 4400'. WOC & tag. (Grayburg San Andres) Circ. csg w/25# per/bbl. s gel & brine
3. POOH to @ 3900'. Spot 15 sxs cmt class C. f/3900-3800 (Queens) WOC & tag.
4. POOH to 2900'. Spot 45 sxs class C cmt. f/2900-2600 (Yates-base of salt) WOC & tag.
5. POOH to 1800'. Spot 15 sxs class C cmt. f/1800-1700 (top of salt)
6. POOH to 450'. Spot 15 sxs Class C cmt. f/450-350 (shoe)
7. POOH to 50'. Spot 10 sxs class C cmt f/50'-surface
8. Cut off wellhead & weld cap & install dry hole marker.

25 SXS MINIMUM

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE RJ Harding III TITLE Operations Engineer DATE 10-5-94

TYPE OR PRINT NAME RJ Harding III TELEPHONE NO. 915-688-4816

(This space for State Use)

Filed by

OCT 12 1994

APPROVED BY _____ TITLE _____ DATE _____

CONDITIONS OF APPROVAL, IF ANY:

THE COMMISSION MUST BE NOTIFIED 24 HOURS BEFORE TO THE BEGINNING OF PLUGGING OPERATIONS FOR THE C-103 TO BE APPROVED