

DISTRICT I
P.O. Box 1980, Hobbs, NM 88240

DISTRICT II
P.O. Drawer DD, Artesia, NM 88210

DISTRICT III
1000 Rio Brazos Rd., Aztec, NM 87410

OIL CONSERVATION DIVISION
P.O. Box 2088
Santa Fe, New Mexico 87504-2088

WELL API NO. 30-025-02143
5. Indicate Type of Lease STATE ☒ FEE ☐
6. State Oil & Gas Lease No. B-4118

SUNDRY NOTICES AND REPORTS ON WELLS (DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)	
1. Type of Well: OIL WELL ☐ GAS WELL ☐ OTHER ☒ Injection	7. Lease Name or Unit Agreement Name Lea
2. Name of Operator Phillips Petroleum Company	8. Well No. 6
3. Address of Operator 4001 Penbrook Street, Odessa, Texas 79762	9. Pool name or Wildcat Vacuum GB/SA
4. Well Location Unit Letter <u>0</u> : <u>1981</u> Feet From The <u>East</u> Line and <u>660</u> Feet From The <u>South</u> Line Section <u>29</u> Township <u>17-S</u> Range <u>34-E</u> NMPM <u>Lea</u> County <u></u>	
10. Elevation (Show whether DF, RKB, RT, GR, etc.) <u>4079' RKB</u>	

11. Check Appropriate Box to Indicate Nature of Notice, Report, or Other Data	
NOTICE OF INTENTION TO:	SUBSEQUENT REPORT OF:
PERFORM REMEDIAL WORK ☐	REMEDIAL WORK ☐
TEMPORARILY ABANDON ☐	ALTERING CASING ☐
PULL OR ALTER CASING ☐	COMMENCE DRILLING OPNS. ☐
OTHER: ☐	PLUG AND ABANDONMENT ☐
	CASING TEST AND CEMENT JOB ☐
	OTHER: <u>SQUEEZE & Repair Casing Leak, Acidize</u> ☒

12. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

10-15-91	RU DDU-Install BOP-COOH w/prod string - and packer- PU workstring- packer and plug. Set down at 3614', COOH.
10-16-91	GIH w/plug and packer. Set plug at 4430', set tension packer every 10 stands. COOH w/TBg - Dump 2 sacks sand on top of plug.
10-17-91	Squeeze set packer 307, pump 150 sks class "CPcmr w/2% CaCl ₂ at 14.8 PPg.
10-19-91	GIH w/bit and collars - drill out cement - COOH. GIH w/ TBg - PU RBP - COOH.
10-20-91	GIH w/bit and collars - clean out to TD - 4774, COOH.
10-21-91	GIH w/workstring & packer - Set at 4354'. Test packer, Swab 3 hrs. Acidize, Pump 1000 gal. 15% NEFE Acid - Drop 250# Rock Salt, Pump 1000 Gal 15% NEFE Acid - Drop 500# Rock Salt - Flush w/24 BBIs 2% KCL.
10-22-91	COOH Lay down work string and treating packer.
10-23-91	GIH/COOH lay down old-string of 2-3/8" PC TBG, P/4 new string of 2-3/8 PC TBG.
10-24-91	-Set packer at 4345'. Drop From Report.

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE <u>L.M. Sanders</u>	TITLE <u>Supervisor Reg/Proration</u>	DATE <u>10-29-91</u>
TYPE OR PRINT NAME <u>L.M. Sanders</u>	TELEPHONE NO. <u>368-1488</u>	

(This space for State Use)

ORIGINAL SIGNED BY JERRY BELOOM
DISTRICT SUPERVISOR

APPROVED BY _____	TITLE _____	DATE _____
CONDITIONS OF APPROVAL, IF ANY:		

REC

OCT 29 1991

NOBBS