

DISTRICT I

P.O. Box 1980, Hobbs, NM 88240

DISTRICT II

P.O. Box Drawer DD, Artesia, NM 88210

DISTRICT III

1000 Rio Brazos Rd., Aztec, NM 87410

OIL CONSERVATION DIVISION

P.O. Box 2088
Santa Fe, New Mexico 87504-2088

WELL API NO.	30-025-02203
5. Indicate Type of Lease	STATE ☒ FEE ☐
6. State Oil / Gas Lease No.	B-1406
7. Lease Name or Unit Agreement Name	WEST VACUUM UNIT
8. Well No.	21
9. Pool Name or Wildcat	VACUUM GRAYBURG SAN ANDRES

SUNDRY NOTICES AND REPORTS ON WELLS
(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO
DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT
(FORM C-101) FOR SUCH PROPOSALS.

1. Type of Well:	OIL WELL ☒ GAS WELL ☐ OTHER ☐
2. Name of Operator	TEXACO EXPLORATION & PRODUCTION INC.
3. Address of Operator	205 E. Bender, HOBBS, NM 88240
4. Well Location	Unit Letter H : 1980 Feet From The NORTH Line and 660 Feet From The EAST Line Section 34 Township 17S Range 34E NMPM LEA COUNTY
10. Elevation (Show whether DF, RKB, RT, GR, etc.)	4034' GR

11. Check Appropriate Box to Indicate Nature of Notice, Report, or Other Data

NOTICE OF INTENTION TO:

PERFORM REMEDIAL WORK ☐	PLUG AND ABANDON ☐
TEMPORARILY ABANDON ☐	CHANGE PLANS ☐
PULL OR ALTER CASING ☐	OTHER: ☐

SUBSEQUENT REPORT OF:

REMEDIAL WORK ☒	ALTERING CASING ☐
COMMENCE DRILLING OPERATION ☐	PLUG AND ABANDONMENT ☐
CASING TEST AND CEMENT JOB ☐	OTHER: ☐
RETURN WELL TO PRODUCTION ☒	

12. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

10-27-99: MIRU. NDWH. NUBOP.
10-28-99: TIH W/BIT, DC'S & TBG. TAG @ 4780'. TIH W/PKR, SN, TBG. SET PKR @ 4308'. TEST CSG.
10-29-99: REL PKR. TIH W/RBP & PKR ON TBG. SET RBP @ 4308'. SET PKR & TEST RBP TO 1000#-OK. LOCATE LEAK @ 1956-87'. PUMP 35 BFW. REL PKR. TIH W/TBG OPEN ENDED TO 2010'. SPOT 2 SX SAND ON RBP.
10-30-99: TIH W/CMT RET ON TBG TO 1848'. PMP THRU RET W/12 BFW. SET RET @ 1848'. TEST TBG TO 2000#-OK. PRESS CSG TO 500#-OK. PUMP 300 SX CL C W/2% CACL. FLSH 2/7 1/2 BFW.
10-31-99: RUN TEMP LOG FROM SURF TO 1813'.
11-01-99: TIH W/BIT & DC'S ON TBG. TAG CMT @ 1813'. DRILL 3' CMT & CMT RET. DRILL 60' HARD CMT TO 1876'.
11-02-99: DRILL CMT FR 1876-1995'. DRILL STRINGERS TO 2125'. TEST SQZ TO 300#. TIH W/CSG GUN & PERF @ 1630'. RU REV UNIT & PUMP THRU SQZ HLS. TIH W/CMT RET ON TBG TO 1530'.
11-04-99: SET RET @ 1530'. PSI CSG TO 300-OK.
11-08-99: TIH W/BIT & DC'S ON TBG. TAG RET @ 1530'. DRILL RET 1530-32'. DRILL CMT 1532-1625'. HARD CMT.
11-09-99: DRILL CMT 1625-40. TIH W/BIT TO 2083'. TAG CMT. DRILL CMT TO 2318'. PULL BIT TO 1600'.
11-10-99: DRILL CMT 2318-2540'. TIH TO 4288'. TAG SAND ON RBP.
11-11-99: TIH W/PKR, SN, TO 1664'. TEST CSG 1664-4288'. LEAK @ 1630'. REL PKR. TIH W/TBG OPEN ENDED TO 1656'. SPOT 50 SX CL C CMT W/2% CC 1656-1176'.
11-15-99: TIH W/BIT, DC'S. TAG CMT 1233'. DRILL TO 1656'. TEST SQZ TO 300#-OK. DRILL STRINGERS TO 1666'.
11-16-99: TIH W/BIT TO 4187'. TAG FILL @ 4288'. WASH FILL & SAND OFF RBP @ 4308'. TIH W/RETR TOOL & TBG TO 4308'. REL RBP. TIH W/PKR, SN, & TBG. PSA 4308'.
11-17-99: ACIDIZE 4390-4785 W/6000 GALS 15% NEFE HCL & 4000# RK SLT. RU SWAB. FL @ SURF. END FL @ 2300'.
11-18-99: FL @ 500'. END FL @ 2500'. RU PUMP TRUCK. SQZ OPEN HLE 4390-4875' W/110 GALS TH-756.
11-19-99: REL PKR. TIH W/BIT & TBG. TAG FILL @ 4802'. C/O TO 4780'. TIH W/OPMA, PERF SUB, SN, TBG, TAC TO 1800'.

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE J. Denise Leake TITLE Engineering Assistant

DATE 12/14/99

TYPE OR PRINT NAME J. Denise Leake

Telephone No. 397-0405

(This space for State Use)

APPROVED

CONDITIONS OF APPROVAL, IF ANY: _____ TITLE _____

DATE _____

11-22-99: NDBOP.N SET TAC. NUWH. OPMA @ 4644'. SN @ 4613'. TAC @ 4330'.

11-23-99: TIH W/GAS ANCHOR, PUMP, K-BARS, RDS. HANG WELL ON. LOAD/TEST TO 500#-
OK. CHECK PUMP ACTION.

12-11-99: ON 24 HR OPT. PUMPED 3 BO, 120 BW, & 6 MCF.

FINAL REPORT