

STATE OF NEW MEXICO
ENERGY AND MINERALS DEPARTMENT

NO. OF COPIES RECEIVED	
DISTRIBUTION	
SANTA FE	
FILE	
U.S.G.S.	
LAND OFFICE	
OPERATOR	

OIL CONSERVATION DIVISION
P. O. BOX 2088
SANTA FE, NEW MEXICO 87501

Form C-103
Revised 10-1-78

5a. Indicate Type of Lease
State ☒ Fee ☐

5. State Oil & Gas Lease No.

B-871

SUNDRY NOTICES AND REPORTS ON WELLS

DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR.
USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.

1. OIL WELL ☒ GAS WELL ☐ OTHER ☐	7. Unit Agreement Name West Vacuum Unit
2. Name of Operator Texaco Producing Inc.	8. Farm or Lease Name
3. Address of Operator P.O. Box 728, Hobbs, New Mexico 88240	9. Well No. 10
4. Location of Well UNIT LETTER <u>D</u> <u>660</u> FEET FROM THE <u>North</u> LINE AND <u>660</u> FEET FROM THE <u>West</u> LINE, SECTION <u>34</u> TOWNSHIP <u>17S</u> RANGE <u>34E</u> NMPM.	10. Field and Pool, or Wildcat Vacuum Grayburg San Andres
15. Elevation (Show whether DF, RT, GR, etc.) 4053 KB	12. County Lea

Check Appropriate Box To Indicate Nature of Notice, Report or Other Data

NOTICE OF INTENTION TO:

PERFORM REMEDIAL WORK ☐
TEMPORARILY ABANDON ☐
PULL OR ALTER CASING ☐
OTHER ☐

PLUG AND ABANDON ☐
CHANGE PLANS ☐
OTHER ☐

SUBSEQUENT REPORT OF:

REMEDIAL WORK ☒
COMMENCE DRILLING OPER. ☐
CASING TEST AND CEMENT JOB ☐
OTHER ☐
ALTERING CASING ☐
PLUG AND ABANDONMENT ☐

17. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1503.

1. MIRU. Pull rods and pump. Install BOP. Pull tubing.
2. TIH with 3-7/8" bit. Clean out fill in wellbore at 4630'-4720'.
3. Spent 300 gals ammonium bicarbonate at 4276-4660'. POH.
4. Perforate Grayburg-San Andres 2 SPI at 4234-39', 4620-24, 4679-83, 4710-18' (24 intervals, 48 shots total).
5. Spent 400 gals 20% NEFE at 4234'-4718'. Set packer at 4073'.
6. Acidize perforations 4234'-4718' with 4000 gals gelled 20% NEFE, 110 gals TH756 scale inhibitor, and 800 lbs rock salt in three stages. AIR 2.5 BPM, Max Pressure 2800 psi ISIP 2200 psi.
7. Pull packer. Run production equipment, remove BOP, and return to production.
24 hour OPT 6-25-87: 18 BO, 27 BW, gravity 36.8, GOR 2138.
Test prior to workover: 1 BO, 2 BW.

18. I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNED A. Gernandt 393-4031 TITLE Area Superintendent DATE JUL 27 1987

ORIGINAL SIGNED BY JERRY SEXTON
DISTRICT I SUPERVISOR

APPROVED BY _____ TITLE _____ DATE _____

RECEIVED
JUL 27 1997
OCD
HOBBS OFFICE