

Submit 3 Copies
to Appropriate
District Office

State of New Mexico
Energy, Minerals and Natural Resources Department

Form C-103
Revised 1-1-89

DISTRICT I
P.O. Box 1980, Hobbs NM 88240

DISTRICT II
P.O. Drawer DD, Artesia, NM 88210

DISTRICT III
1000 Rio Brazos Rd., Aztec, NM 87410

OIL CONSERVATION DIVISION

P.O. Box 2088
Santa Fe, New Mexico 87504-2088

WELL API NO.	30-025-02835
5. Indicate Type of Lease	STATE <input checked="" type="checkbox"/> FEE <input type="checkbox"/>
6. State Oil & Gas Lease No.	B-2245-6
7. Lease Name or Unit Agreement Name	EAST VACUUM GB/SA UNIT TRACT 2054
8. Well No.	001
9. Pool name or Wildcat	VACUUM GB/SA

SUNDRY NOTICES AND REPORTS ON WELLS (DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)	
1. Type of Well: OIL WELL <input checked="" type="checkbox"/> GAS WELL <input type="checkbox"/> OTHER	
2. Name of Operator Phillips Petroleum Company	
3. Address of Operator 4001 Penbrook Street, Odessa, TX 79762	
4. Well Location Unit Letter <u>M</u> : <u>330</u> Feet From The <u>SOUTH</u> Line and <u>660</u> Feet From The <u>WEST</u> Line Section <u>20</u> Township <u>17 S</u> Range <u>35 E</u> NMPM <u>LEA</u> County	
10. Elevation (Show whether DF, RKB, RT, GR, etc.) 3979' 6L	

11. Check Appropriate Box to Indicate Nature of Notice, Report, or Other Data

NOTICE OF INTENTION TO:

PERFORM REMEDIAL WORK ☐ PLUG AND ABANDON ☒
TEMPORARILY ABANDON ☐ CHANGE PLANS ☐
PULL OR ALTER CASING ☐
OTHER: ☐

SUBSEQUENT REPORT OF:

REMEDIAL WORK ☐ ALTERING CASING ☐
COMMENCE DRILLING OPNS. ☐ PLUG AND ABANDONMENT ☐
CASING TEST AND CEMENT JOB ☐
OTHER: ☐

12. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

1. MIRU DDU. GIH WITH ON/OFF TOOL TO PKR @4195'. RELEASE & COOH. GIH AND SET CIBP AT 4195'.
2. SPOT PLUG NO. 1 (60 SX CMT) 4195'-3781'. COVERS GB/SA AND LINER TOP.
3. PERFORATE 7" CSG AND SQZ UNDER PKR W/PLUG NO. 2 (65 SX CMT) 2955'-2855'. COVERS THE YATES.
4. FREE POINT AND BACK OFF 7" CSG. NEED TO PULL 1855'.
5. SPOT PLUG NO. 3 (75 SX CMT) 1905'-1705'. WOC TAG PLUG. COVERS SALT TOP AND CSG SHOE.
6. PERFORATE 8-5/8" CSG AT 400'. PUMP PLUG NO. 4 (250 SX CMT) DOWN CSG, THRU PERFS AT 400' AND BACK TO SURFACE OUTSIDE CSG LEAVING THE CSG FULL.
7. CUT OFF CSG 3' BELOW GROUND LEVEL. INSTALL MONUMENT MARKER. PERFORM RECLAMATION WORK.

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE [Signature] TITLE SUPERVISOR, REG. AFFAIRS DATE 3/31/95

TYPE OR PRINT NAME L. M. SANDERS TELEPHONE NO. 915/368-1488

(This space for State Use)

ORIGINAL SIGNED BY
GARY WINK
FIELD REP. II

APPROVED BY _____ TITLE _____ DATE APR 04 1995

CONDITIONS OF APPROVAL, IF ANY: