

Submit 3 Copies  
to Appropriate  
District Office

State of New Mexico  
Energy, Minerals and Natural Resources Department

Form C-103  
Revised 1-1-89

DISTRICT I  
P.O. Box 1980, Hobbs NM 88240

DISTRICT II  
P.O. Drawer DD, Artesia, NM 88210

DISTRICT III  
1000 Rio Brazos Rd., Aztec, NM 87410

**OIL CONSERVATION DIVISION**

P.O. Box 2088  
Santa Fe, New Mexico 87504-2088

WELL API NO.	30-025-02862
5. Indicate Type of Lease	STATE <input checked="" type="checkbox"/> FEE <input type="checkbox"/>
6. State Oil & Gas Lease No.	B-1713
7. Lease Name or Unit Agreement Name	EAST VACUUM GB/SA UNIT TRACT 2335
8. Well No.	001
9. Pool name or Wildcat	VACUUM GB/SA
10. Elevation (Show whether DF, RKB, RT, GR, etc.)	

**SUNDRY NOTICES AND REPORTS ON WELLS**  
(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A  
DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT"  
(FORM C-101) FOR SUCH PROPOSALS.)

1. Type of Well:  
OIL WELL ☒ GAS WELL ☐ OTHER ☐

2. Name of Operator  
Phillips Petroleum Company

3. Address of Operator  
4001 Penbrook Street, Odessa, TX 79762

4. Well Location  
Unit Letter N : 330 Feet From The SOUTH Line and 1980 Feet From The WEST Line  
Section 23 Township 17S Range 35E NMPM LEA County

11. Check Appropriate Box to Indicate Nature of Notice, Report, or Other Data	
<b>NOTICE OF INTENTION TO:</b>	<b>SUBSEQUENT REPORT OF:</b>
PERFORM REMEDIAL WORK <input type="checkbox"/>	REMEDIAL WORK <input type="checkbox"/>
TEMPORARILY ABANDON <input type="checkbox"/>	ALTERING CASING <input type="checkbox"/>
PULL OR ALTER CASING <input type="checkbox"/>	COMMENCE DRILLING OPNS. <input type="checkbox"/>
OTHER: <input type="checkbox"/>	PLUG AND ABANDONMENT <input type="checkbox"/>
	CASING TEST AND CEMENT JOB <input type="checkbox"/>
	OTHER: <u>SWAB TESTED</u> <input checked="" type="checkbox"/>

12. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

10/31/94 MIRU. NU BOP AND PU 2-3/8" WORKSTRING TRIP CSG SCRAPER TO 4177'. PU PKR START IN HOLE.  
11/01/94 FINISH GIH W/PKR. SET @ 4148'. LOAD TO TEST-WOULD NOT TEST. SWABBED.  
11/02/94 SWABBED.  
11/03/94 RELEASE PKR. COOH. GIH W/CIBP, PKR, AND TBG. SET CIBP AT 4150'. SET PKR AT 4120'. LOAD AND TEST CIBP TO 1000#. OK (NO CHART RAN AND NO PKR FLUID PUMPED) COOH LD TBG. ND BOP RDMO DDU. P & A PROCEDURE WILL FOLLOW.

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE L. M. Sanders TITLE SUPERVISOR, REG. AFFAIRS DATE 11/07/94

TYPE OR PRINT NAME L. M. SANDERS TELEPHONE NO. 915/368-1488

(This space for State Use)

APPROVED BY \_\_\_\_\_ TITLE \_\_\_\_\_ DATE \_\_\_\_\_

CONDITIONS OF APPROVAL, IF ANY:

NOV 09 1994