Submit 3 Copies To Appropriate District State of New Mexico Form C-103 Office Energy, Minerals and Natural Resources Revised March 25, 1999 District I WELL API NO. 1625 N. French Dr., Hobbs, NM 87240 30-025-02909 District II OIL CONSERVATION DIVISION 811 South First, Artesia, NM 87210 5. Indicate Type of Lease 2040 South Pacheco District III STATE X 1000 Rio Brazos Rd., Aztec, NM 87410 Santa Fe, NM 87505 FEE District IV 6. State Oil & Gas Lease No. 2040 South Pacheco, Santa Fe, NM 87505 A-1320 SUNDRY NOTICES AND REPORTS ON WELLS 7. Lease Name or Unit Agreement Name: (DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.) East Vacuum GB/SA Unit 1. Type of Well: Tract 2801 Oil Well Gas Well Other 2. Name of Operator 8. Well No. Phillips Petroleum Company 3. Address of Operator 9. Pool name or Wildcat 4001 Penbrook Street Odessa, Texas 79762 Vacuum GB/SA 4. Well Location Unit Letter 660 South 660 feet from the_ line and _ feet from the_ Section 28 Township 17-S Range County Lea 10. Elevation (Show whether DR, RKB, RT, GR, etc.) 3960' DF 11. Check Appropriate Box to Indicate, Nature of Notice, Report, or Other Data NOTICE OF INTENTION TO: SUBSEQUENT REPORT OF: PERFORM REMEDIAL WORK PLUG AND ABANDON REMEDIAL WORK ALTERING CASING **TEMPORARILY ABANDON** COMMENCE DRILLING OPNS. CHANGE PLANS PLUG AND ABANDONMENT PULL OR ALTER CASING MULTIPLE CASING TEST AND COMPLETION **CEMENT JOB** OTHER: OTHER: Temporarily Abandon X 12. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work). SEE RULE 1103. For Multiple Completions: Attach wellbore diagram of proposed completion or recompilation. 09/11/02: MIRU WSU. KILL WELL. STARTED POOH W/RODS & PLUNGER. WELL STARTED FLOWING UP TUBING. SHUT DOWN. CIRCULATE 10 LB BRINE. UNABLE TO KILL WELL. SHUT DOWN & SECURE WELL. 09/12/02: KILL WELL. POOH W/RODS & PLUNGER. TIH W/STANDING VALVE FISHING TOOL & RODS. COULDN'T LATCH ONTO STANDING VALVE. POOH LAYING DOWN RODS & FISHING TOOL. SECURE WELL & SHUT DOWN. 09/13/02-09/14/02: CREW OFF. This Approval of Temporary Abandonment Expires 09/15/02: MIRU HES. TIH W/PERFORATING GUN & SHOT HOLES IN TBG @ 45/5 . FOOH W/PERFORTING GUN & SHOT HOLES IN TBG @ 45/5 . FOOH W/PERFORTING GUN & SHOT HOLES IN TBG @ 45/5 . KILL WELL. COULDN'T KILL WELL W/10 LB BRINE. PUMPED 6 BBLS 14.5 MUD DOWN TBG & 19 BBLS 14.5 LB MUD DOWN CSG. ND WELL-HEAD. NU BOP. POOH W/TBG. LEAVE KILL STRING IN THE HOLE. SECURE WELL & SHUT DOWN. ** CONTINUED ON BACK *** I hereby certify that the information above is true and complete to the best of my knowledge and belief. SIGNATURE. _ TITLE Supervisor, Regulatory Affairs DATE _ Type or print name 1. M. Sanders Telephone No. 915/368-1488 (This space for State use)

APPROVED BY

Conditions of approval, if any:

DAUCT 3 0 2002

East Vacuum GB/SA Unit #2801-008

09/16/02: OPEN WELL. NO PRESSURE ON TBG. OR CSG. FINISH POOH W/TBG. TIH W/BIT, SCRAPER, & TBG TO 4135'. POOH W/TBG, SCRAPER & BIT. TIH W/CIBP & TBG. SET CIBP @ 4101'. LAY DOWN 1 JT TBG. RU PUMP TRUCK TO CSG. TEST CSG TO 500 PSI FOR 30 MINUTES. HELD GOOD. CIRCULATE PACKER FLUID. RD PUMP TRUCK. POOH LAYING DOWN TBG. SECURE WELL & SHUT DOWN.

09/17/02: FINISH LAYING DOWN TBG. ND BOP. NU WELL-HEAD LEAVING A 8' SUB W/A 2" BALL VALVE IN THE SLIPS. CLEAN LOCATION RDMO WSU. FINISH FILLING UP CSG W/PKR FLUID W/PUMP TRUCK. WELL TA'D, COMPLETE DROP FROM REPORT.

CHART ATTACHED