

7/8/02: FINISHED DRILLING CEMENT TO 1170'. TESTED CSG TO 500 PSI, HELD OK. LAID DOWN POWER SWIVEL. GIH W/TBG TO TIGHT SPOT @ 3100', NO PROBLEMS. COOH W/TBG. LEFT KILL STRING IN HOLE. SDFN.

7/9/02: TESTED CSG TO 500 PSI FOR 30 MINUTES, HELD OK. CUT TEST CHART. COOH W/TBG, DC'S, & BIT. GIH W/ DC'S & NEW BIT. DRILLED OUT CIBP. KILLED WELL AFTER DRILLING OUT CIBP. CIRCULATED HOLE W/10# BRINE.

7/10/02: KILLED WELL. FINISHED DRILLING CIBP & CLEANED OUT WELL TO 4635'. CIRCULATED HOLE CLEAN. KILL WELL, HAVING TROUBLE KEEPING WELL DEAD. COOH W/TBG, LEFT KILL STRING IN HOLE.

7/11/02: KILL WELL. COOH W/KILL STRING. GIH W/PRODUCTION STRING. WELL STARTED FLOWING. PUMPED BRINE TO KILL WELL. UNABLE TO KILL WELL. HOOKED UP FLOWLINE & FLOWED BACK WELL TO SATELLITE. SDFN.

7/12/02: PUMPED BRINE TO KILL WELL. GIH W/REST OF PRODUCTION STRING. SHUT DOWN FOR WEEKEND.

7/13/02: SHUT DOWN FOR WEEKEND.

7/14/02: SHUT DOWN FOR WEEKEND.

7/15/02: KILL WELL. NIPPLED DOWN BOP. UNABLE TO SET TBG ANCHOR. NIPPLED UP BOP. COOH W/PRODUCTION STRING. CHANGED OUT TBG ANCHOR & GIH W/PRODUCTION STRING. NIPPLED DOWN BOP, SET TBG ANCHOR & FLANGED UP WELLHEAD. SDFN.

7/16/02: BLED PRESSURE OFF WELL. GIH W/RODS & PUMP. COULD NOT GET PUMP TO BOTTOM. COOH W/ RODS & PUMP. NIPPLED UP BOP. COOH W/TBG, LEFT KILL STRING IN HOLE. SDFN.

7/17/02: KILLED WELL. COOH W/PRODUCTION STRING. LAID DOWN BOTTOM 17 JTS 2-7/8 TBG. CHANGED OUT TBG ANCHOR & GIH W/PRODUCTION STRING. NIPPLED DOWN BOP, SET TBG ANCHOR, & FLANGED UP WELLHEAD. GIH W/RODS & PUMP. LOADED & TESTED PUMP. WELL BACK ON PRODUCTION.

7/18/02: RIGGED DOWN DDU. WELL BACK ON PRODUCTION

CHART IS ATTACHED