

OIL CONSERVATION DIVISION

P. O. BOX 2088
SANTA FE, NEW MEXICO 87501

Form C-103
Revised 10-1-78

NO. OF COPIES RECEIVED	
CITY	
SANTA FE	
FILE	
U.S.G.S.	
LAND OFFICE	
OPERATOR	

5a. Indicate Type of Lease	
State ☒	Fee ☐
5. State Oil & Gas Lease No.	
B-1553	

SUNDRY NOTICES AND REPORTS ON WELLS

DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO OPERATE OR PLUG BACK TO A DIFFERENT RESERVOIR.
USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.

1. ☒ OIL WELL ☐ GAS WELL ☐ OTHER		7. Unit Agreement Name
2. Name of Operator		8. Farm or Lease Name
Texaco Producing Inc.		
3. Address of Operator		9. Well No.
P. O. Box 728, Hobbs, NM 88240		31
4. Location of Well		10. Field and Pool, or Vicinity
UNIT LETTER C 660 FEET FROM THE North LINE AND 1980 FEET FROM		Lovington San Andres
THE West LINE, SECTION X / TOWNSHIP 17S RANGE 36E N.M.P.M.		
15. Elevation (Show whether SF, RT, GR, etc.)		12. County
3845' DF		Lea

Check Appropriate Box To Indicate Nature of Notice, Report or Other Data
NOTICE OF INTENTION TO: SUBSEQUENT REPORT OF:

PERFORM REMEDIAL WORK ☒	PLUG AND ABANDON ☐	REMEDIAL WORK ☐	ALTERING CASING ☐
TEMPORARILY ABANDON ☐	CHANGE PLANS ☐	COMMENCE DRILLING OPERATIONS ☐	PLUG AND ABANDONMENT ☐
PULL OR ALTER CASING ☐	OTHER ☐	CASING TEST AND CEMENT JOBS ☐	

17. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

- 1) MIRU. Pull rods & pump.
- 2) Install BOP. Pull tbg.
- 3) GIH w/4 3/4" bit. Clean out to TD.
- 4) GIH w/RBP to +4500'.
- 5) Pressure test casing to 500#. Repair if necessary.
- 6) GIH w/4 3/4" bit. Deepen from 4910-5125' (165')
- 7) Run GR-CNL-CAL-CCL 5125-2500'.
- 8) GIH w/packer to +4500'. Load backside.
- 9) Acidize San Andres OH 4541-5120' w/10,000 gal gelled 15% NEFE in 3 stages.
Use +1000# rocksalt between each stage as a block. Mix 2 drums scale inhibitor with the acid (5BPM, 4000#)
- 10) Flow back load.
- 11) GIH w/RBP to +4530'.
- 12) Perf Grayburg 4330-4530 w/4" csg gun w/2JSPI.
- 13) GIH w/packer to +4250'.
- 14) Acidize BG perms w/5000 gal gelled 15% NEFE and ball sealers. Mix 1 drum scale inhibitor w/the acid (5BPM, 4000#).
- 15) Flow back load.
- 16) Pull RBP.
- 17) Place on production.

18. I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNED [Signature] TITLE District Admin. Supervisor DATE 09/24/86

ORIGINAL SIGNED BY JERRY SEXTON

APPROVED BY DISTRICT SUPERVISOR TITLE DATE OCT 3 1986

CONDITIONS OF APPROVAL, IF ANY: