

Submit 3 Copies
to Appropriate
District Office

State of New Mexico
Energy, minerals and Natural Resources Department

Form C-103
Revised 1-1-89

DISTRICT I
P.O. Box 1980, Hobbs, NM 88240

OIL CONSERVATION DIVISION
310 Old Santa Fe Trail, Room 206
Santa Fe, New Mexico 87503

DISTRICT II
P.O. Drawer DD, Artesia, NM 88210

DISTRICT III
1000 Rio Brazos Rd., Aztec, NM 87410

WELL API NO.
30-025-03954

5. Indicate Type of Lease
STATE FEE

6. State Oil & Gas Lease No.
E-5221 (Expired)

SUNDRY NOTICES AND REPORTS ON WELLS
(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A
DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT"
(FORM C-101) FOR SUCH PROPOSALS.)

7. Lease Name or Unit Agreement Name
STATE VE

1. Type of Well:
OIL WELL GAS WELL OTHER

2. Name of Operator
PENROC OIL CORPORATION

8. Well No. 1

3. Address of Operator
P.O. Box 5970, Hobbs, NM 88241

9. Pool name or Wildcat
VACUUM GRAYBUG SA

4. Well Location
Unit Letter P : 660 Feet From The SOUTH Line and 660 Feet From The EAST Line
Section 31 Township 17 S Range 36 E NMPM LEA County

10. Elevation (Show whether DF, RKB, RT, GR, etc.)
3866 GL

11. Check Appropriate Box to Indicate Nature of Notice, Report, or Other Data

NOTICE OF INTENTION TO:		SUBSEQUENT REPORT OF:	
PERFORM REMEDIAL WORK <input type="checkbox"/>	PLUG AND ABANDON <input type="checkbox"/>	REMEDIAL WORK <input type="checkbox"/>	ALTERING CASING <input type="checkbox"/>
TEMPORARILY ABANDON <input type="checkbox"/>	CHANGE PLANS <input type="checkbox"/>	COMMENCE DRILLING OPNS. <input type="checkbox"/>	PLUG AND ABANDONMENT <input checked="" type="checkbox"/>
PULL OR ALTER CASING <input type="checkbox"/>		CASING TEST AND CEMENT JOB <input type="checkbox"/>	
OTHER: <input type="checkbox"/>		OTHER: <input type="checkbox"/>	

12. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.
8.30.96 - 9.3.96
RU W.O. Rig. Pulled 144-5/8" & 58-3/4" rods & pump. LD same.
Pulled 162 jbs. of 2 3/8" tubing. RU Computalog. Ran gauge ring - o.k. to 5000'.
Ran 5 1/2" CIBP to 5000'. Set same. TTH w/ tbg and tag CIBP @ 5000'.
PU. Circulate hole w/ 10" salt gel. Pumped & spotted 20 sx. cement plug
on top of CIBP. Ran free point casing 510' and up. TTH w/ tbg and
spotted 100 sx. plug @ 4000'. w.o.c. 4 hrs. Tagged - o.k. Pulled up to
1800' and set 100 sx. plug. LD tbg to 500'. RU wireline. Cut & pulled
500' (14 jbs + stub). LD same. Pumped 100 sx. plug 50' in & out. w.o.c.
4 hrs. Tagged @ 410'. Set 10 sx. plug @ surface. Install DHM. Clean up.

I hereby certify that the information above is true and complete to the best of my knowledge and belief.
SIGNATURE Phyllis Merchant TITLE President DATE 9.6.96
TYPE OR PRINT NAME M. Y. (Merch) Merchant TELEPHONE NO. (505) 397-3596

(This space for State Use)
APPROVED BY Johnny Rehner TITLE _____ DATE APR 17 1997
CONDITIONS OF APPROVAL, IF ANY: _____