	•		
ALL OF COPIES RECEIVED			
DISTRIBUTION			Form C-103 Supersedes Old
MATA FE		SERVATION COMMISSION	C-102 and C-103
FILE		SERVATION COMMISSION	Effective 1-1-65
U.S.G.5.			
LAND OFFICE	-		5a. Indicate Type of Lease
OPERATOR			
			5. State Oil & Gas Lease No.
(DO NOT USE THIS FOR FOR FOR FOR	RY NOTICES / 10 DEPORTS ON HOPOSALS TO DELLE AT TOBLETEN OF PLUG S TION FOR PERMIT - 1 STATE C-131) FOR SUC	I WELLS BACK TO A DIFFERENT RESERVOIR.	
···			7. Unit Agreement Name
WELL WELL	OTHER. Salt Water Disp	osaal	
2. Name of Operator			8. Farm or Lease Name
Amerada Hess (	Knowles SWD		
3. Address of Operator			9. Well No.
Drawer "D", Monument, New Mexico 88265			<sup>1</sup> 1
4. Location of Well			10. Field and Pool, or Wildcat
UNIT LETTER D . 660 FEET FROM THE NORTH LINE AND 660 FEET FROM			Knowles
i			<b>MINIMUM</b>
THE West LINE, SECTION 2 TOWNSHIP 17-S RANGE 38-E NMPM.			
	15. Elevation (Show whether	DF, RT, GR, etc.)	12. County
$\overline{\mathbf{v}}$			Lea
16. Check	Appropriate Box To Indicate N	ature of Notice Report of Or	
NOTICE OF I	NTENTION TO:		
		SUBSEQUEN	T REPORT OF:
PERFORM REMEDIAL WORK	PLUG AND ABANDON XX	REMEDIAL WORK	
TEMPORARILY ABANDON		COMMENCE DRILLING OPNS.	ALTERING CASING
PULL OR ALTER CASING	CHANGE PLANS	CASING TEST AND CEMENT JOB	PLUG AND ABANDONMENT
_		OTHER	<b></b>
OTHER			L
17 17 19 19 19 19 19 19 19 19 19 19 19 19 19			
17. Describe Freposed or Completed C	perations (Clearly state all partie and day		and the second

beschube risposed of Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

Attempted to pull tubing & packer. Pulled 58 jts. tbg. Tbg. had parted. Top of fish at 1773'. Washed & milled to top of packer at 1869'. Recovered scale & iron sulfide. Washed, drilled & milled. Recovered packer and pieces of tubing. Washed, reamed & milled on fish to 2584'. Recovered pieces of tubing & scale. Unable to go deeper.

PLAN TO: Clean out with bit & casing scraper. Set bridge plug at 2450' w/35' cement on top. Cut & pull 5-1/2" casing from 2376'. Spot 75 sx. cement plug in top of 8-5/8" casing at 1300'. Spot 85 sx. cement plug at 300'. Spot 10sx. cement in surface casing with dry hole marker. Plug and abandon.

\$ 100' PUUG

 $\sim$ 

18. I hereby certify that the information above is true and complete to the best of my knowledge and belief. - 1 1

SIGNED MOSlach	Supver., Admin. Services	DATE 10-24-75
APPROVED BY Server Sector		
CONDITION OF APPROVAL, IF ANY:	TITLE	DATE

# 100'