

NO. OF COPIES RECEIVED		
DISTRIBUTION		
SANTA FE		
FILE		
U.S.G.S.		
LAND OFFICE		
OPERATOR		

NEW MEXICO OIL CONSERVATION COMMISSION

Form C-103
Supersedes Old
C-102 and C-103
Effective 1-1-65

5a. Indicate Type of Lease
State <input checked="" type="checkbox"/> Fee <input type="checkbox"/>
5. State Oil & Gas Lease No.

SUNDRY NOTICES AND REPORTS ON WELLS (DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT -" (FORM C-101) FOR SUCH PROPOSALS.)

1. OIL WELL <input checked="" type="checkbox"/> GAS WELL <input type="checkbox"/> OTHER <input type="checkbox"/>	7. Unit Agreement Name
2. Name of Operator Mobil Oil Corporation	8. Farm or Lease Name State P
3. Address of Operator Box 633, Midland, Texas 79701	9. Well No. 3
4. Location of Well UNIT LETTER <u>B</u> , <u>660</u> FEET FROM THE <u>North</u> LINE AND <u>1980</u> FEET FROM THE <u>East</u> LINE, SECTION <u>26</u> TOWNSHIP <u>17-S</u> RANGE <u>35-E</u> NMPM.	10. Field and Pool, or Wildcat Vac Grayburg S.A.
15. Elevation (Show whether DF, RT, GR, etc.) 3921 GR	12. County

Check Appropriate Box To Indicate Nature of Notice, Report or Other Data NOTICE OF INTENTION TO: SUBSEQUENT REPORT OF:

PERFORM REMEDIAL WORK <input type="checkbox"/>	PLUG AND ABANDON <input checked="" type="checkbox"/>	REMEDIAL WORK <input type="checkbox"/>	ALTERING CASING <input type="checkbox"/>
TEMPORARILY ABANDON <input type="checkbox"/>	CHANGE PLANS <input type="checkbox"/>	COMMENCE DRILLING OPNS. <input type="checkbox"/>	PLUG AND ABANDONMENT <input type="checkbox"/>
PULL OR ALTER CASING <input type="checkbox"/>	OTHER <input type="checkbox"/>	CASING TEST AND CEMENT JOBS <input type="checkbox"/>	OTHER <input type="checkbox"/>

7. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

1. MIRU a pulling Unit.

2. Set a CIBP immediately above the San Andress open hole and cap w/35' cmt (10sax)

3. Load the hole w/9.5#/gal mud laden fluid.

4. Locate free point of 7" csg. shoot and pull approx 2400'.

5. Salt is located 1775' (top) to 2765' (bottom). Spot 100' cement plug across bottom and/or top if in open hole. (45 sax per plug) Spot also a 100' plug across 7" stub. (35 sx).

6. Spot a 100' plug across 9-5/8" shoe at 1696' (45 sx)

7A. Spot 10 sx plug at surface.

7. Cut off the casinghead. Clean up and level the location. Erect Monument.

Notify NMOOC 24 hr before starting P&A 393-6161.

Verbal approved by NMOOC

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNED Christine O. Tucker TITLE Authorized Agent DATE 4-28-75

APPROVED BY [Signature] TITLE [Signature] DATE APR 30 1975

CONDITIONS OF APPROVAL, IF ANY: