

NO. OF COPIES RECEIVED	
DISTRIBUTION	
SANTA FE	
FILE	
U.S.G.S.	
LAND OFFICE	
OPERATOR	

NEW MEXICO OIL CONSERVATION COMMISSION

Form C-103
Supersedes Old
C-102 and C-103
Effective 1-1-65

5a. Indicate Type of Lease
State <input checked="" type="checkbox"/> Fee <input type="checkbox"/>

5. State Oil & Gas Lease No.
E 8563

SUNDRY NOTICES AND REPORTS ON WELLS (DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)

1. OIL WELL <input checked="" type="checkbox"/> GAS WELL <input type="checkbox"/> OTHER <input type="checkbox"/>	7. Unit Agreement Name
2. Name of Operator Supron Energy Corporation	8. Farm or Lease Name Lovington 9
3. Address of Operator Suite 1700, 8350 N. Central Expwy, Dallas, TX 75206	9. Well No. 1
4. Location of Well UNIT LETTER M 500 FEET FROM THE South LINE AND 500 FEET FROM West LINE, SECTION 9 TOWNSHIP 17 South RANGE 37 East N.M.P.M.	10. Field and Pool, or Wildcat Midway Abo
15. Elevation (Show whether DF, RT, GR, etc.) 3770.4' GR	12. County Lea

Check Appropriate Box To Indicate Nature of Notice, Report or Other Data NOTICE OF INTENTION TO: SUBSEQUENT REPORT OF:

PERFORM REMEDIAL WORK <input type="checkbox"/>	PLUG AND ABANDON <input type="checkbox"/>	REMEDIAL WORK <input type="checkbox"/>	ALTERING CASING <input type="checkbox"/>
TEMPORARILY ABANDON <input type="checkbox"/>	CHANGE PLANS <input type="checkbox"/>	COMMENCE DRILLING OPNS. <input type="checkbox"/>	PLUG AND ABANDONMENT <input checked="" type="checkbox"/>
PULL OR ALTER CASING <input type="checkbox"/>	OTHER <input type="checkbox"/>	CASING TEST AND CEMENT JOB <input type="checkbox"/>	OTHER <input type="checkbox"/>

17. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent date, including estimated date of starting any proposed work) SEE RULE 1103.

1. Rigged up well service rig.
2. Pulled rods & tubing. Ran Go International Cast Iron plug. Set @ 8794. Pumped 35 sxs cement on top of plug.
3. Shot 4½" casing off and pulled out of hole. Set cement plug from 5820-6175' w/50 sxs.
4. Set cement plug 3425-3594' w/50 sxs.
5. Shut 8 5/8" casing off @ 1010' and pulled casing. Set cement plug 950-1060' w/45 sxs.
6. Set cement plug 240-360' w/65 sxs.
7. Set 10 sx plug @ surface. Erected dry hole marker. Job complete 12/19/76.

18. I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNED <u>Nathan E. Oleg</u>	TITLE <u>Operations Assistant</u>	DATE <u>August 23, 1977</u>
APPROVED BY <u>Nathan E. Oleg</u>	TITLE <u>OIL & GAS SUPERVISOR</u>	DATE <u>August 1, 1978</u>
CONDITIONS OF APPROVAL, IF ANY:		