

OIL CONSERVATION DIVISION

P. O. BOX 2088
SANTA FE, NEW MEXICO 87501

Form C-103
Revised 10-1-78

NO. OF COPIES RECEIVED	
DISTRIBUTION	
SANTA FE	
FILE	
U.S.G.S.	
LAND OFFICE	
OPERATOR	

5a. Indicate Type of Lease	
State <input checked="" type="checkbox"/>	Fee <input type="checkbox"/>
5. State Oil & Gas Lease No.	
B-155	

SUNDRY NOTICES AND REPORTS ON WELLS

(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT -" (FORM C-101) FOR SUCH PROPOSALS.)

1. <input checked="" type="checkbox"/> OIL WELL <input type="checkbox"/> GAS WELL <input type="checkbox"/> OTHER-		7. Unit Agreement Name
2. Name of Operator Texaco, Inc.		8. Farm or Lease Name M. M. '0' St. NCT-1
3. Address of Operator P. O. Box 728, Hobbs, New Mexico 88240		9. Well No. 13
4. Location of Well UNIT LETTER <u>N</u> <u>519</u> FEET FROM THE <u>South</u> LINE AND <u>1830</u> FEET FROM THE <u>West</u> LINE, SECTION <u>36</u> TOWNSHIP <u>17-S</u> RANGE <u>34-E</u> NMPM.		10. Field and Pool, or Wildcat Vacuum Glorieta
15. Elevation (Show whether DF, RT, GR, etc.) 3997' (GR)		12. County Lea

Check Appropriate Box To Indicate Nature of Notice, Report or Other Data

NOTICE OF INTENTION TO:

SUBSEQUENT REPORT OF:

PERFORM REMEDIAL WORK <input type="checkbox"/>	PLUG AND ABANDON <input type="checkbox"/>	REMEDIAL WORK <input type="checkbox"/>	ALTERING CASING <input type="checkbox"/>
TEMPORARILY ABANDON <input type="checkbox"/>	CHANGE PLANS <input type="checkbox"/>	COMMENCE DRILLING OPNS. <input type="checkbox"/>	PLUG AND ABANDONMENT <input type="checkbox"/>
PULL OR ALTER CASING <input type="checkbox"/>	OTHER <u>Repair Water Flow</u> <input checked="" type="checkbox"/>	CASING TEST AND CEMENT JOB <input type="checkbox"/>	

17. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

1. Rig up. Pull production equipment. Install BOP. Pull tubing.
2. Set BOP in 2 7/8" Glorieta string @ 5000'.
3. Perforate 2 7/8" Blinberry string & 8 5/8" Csg string w/2-JS @ 1575'.
4. Cement perms. @ 1575' w/approx. 700 sx. class 'II' cement. Circulate cement. Squeeze w/addl. 200 sx. class 'II' cement. WOC Test.
5. Install production equipment. Test & return to production.

18. I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNED [Signature] TITLE Asst. Dist. Supt. DATE 12/19/80

APPROVED BY Jerry Sexton TITLE Dist. 1 Supt. DATE 12/24/80

CONDITIONS OF APPROVAL, IF ANY: