

STATE OF NEW MEXICO  
ENERGY AND MINERALS DEPARTMENT

OIL CONSERVATION DIVISION

P. O. BOX 2088

SANTA FE, NEW MEXICO 87501

Form C-103  
Revised 10-1-78

NO. OF COPIES RECEIVED	
DISTRIBUTION	
SANTA FE	
FILE	
U.S.G.S.	
LAND OFFICE	
OPERATOR	

5a. Indicate Type of Lease  
State ☒ Fee ☐

5. State Oil & Gas Lease No.

B-155-1

SUNDRY NOTICES AND REPORTS ON WELLS

(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR.  
USE "APPLICATION FOR PERMIT -" (FORM C-101) FOR SUCH PROPOSALS.)

1. OIL WELL <input checked="" type="checkbox"/> GAS WELL <input type="checkbox"/> OTHER <input type="checkbox"/>	7. Unit Agreement Name
2. Name of Operator TEXACO INC.	8. Farm or Lease Name N.M. "O" ST. (NCT-1)
3. Address of Operator P. O. Box 728, Hobbs, New Mexico 88240	9. Well No. 20
4. Location of Well UNIT LETTER E 467 FEET FROM THE West LINE AND 1980 FEET FROM THE North LINE, SECTION 36 TOWNSHIP 17-S RANGE 34-E N.M.P.M.	10. Field and Pool, or Wildcat Vacuum Glorieta
15. Elevation (Show whether DF, RT, GR, etc.) 4016' (DF)	12. County lea

16. Check Appropriate Box To Indicate Nature of Notice, Report or Other Data

NOTICE OF INTENTION TO:	SUBSEQUENT REPORT OF:
PERFORM REMEDIAL WORK <input type="checkbox"/>	REMEDIAL WORK <input type="checkbox"/>
TEMPORARILY ABANDON <input type="checkbox"/>	COMMENCE DRILLING OPNS. <input type="checkbox"/>
PULL OR ALTER CASING <input type="checkbox"/>	CASING TEST AND CEMENT JOBS <input type="checkbox"/>
OTHER Repair water flow <input checked="" type="checkbox"/>	OTHER <input type="checkbox"/>
PLUG AND ABANDON <input type="checkbox"/>	ALTERING CASING <input type="checkbox"/>
CHANGE PLANS <input type="checkbox"/>	PLUG AND ABANDONMENT <input type="checkbox"/>

17. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

1. Rig up. Pull rods & pump. Install BOP.
2. Set RBP @ 5000' in the Glorieta string.
3. Set RBP @ 5000' in the abandoned Blinebry string.
4. Perforate Blinebry string away from Glorieta w/2 jts @ 1570'.
5. Cement to surface 2-7/8" csg perfs @ 1570' w/800 sx Cl H cement. Sqz w/addl. 150 sx Cl H cmt. WOC. DOC. Test.
6. Pull RBP's. Install pumping equipment. Test & return to production.

18. I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNED J. L. Schuff TITLE Asst. Dist. Mgr. DATE 8-6-82

ORIGINAL SIGNED BY JERRY SUTTON TITLE  DATE AUG 11 1982

APPROVED BY  TITLE  DATE

CONDITIONS OF APPROVAL, IF ANY: