

McCallister State No. 2
Description of Workover
(6/27/97 - 7/10/97)

1. Pulled production equipment.
2. Set CIBP @ 12,050' with 35' of cement on top.
3. Set CIBP @ 10,248' with 35' of cement on top.
4. Ran wire line and selectively perforated Penn from 9908' - 10,158'.
5. Ran RBP and packer, set RBP @ 10,183' and packer @ 10,035'.
6. Acidized well with 20,000 gal of 15%.
7. Swab spent acid back.
8. Pulled packer and RBP.
9. Ran production equipment.