

DISTRICT I

P.O. Box 1980, Hobbs, NM 88240

DISTRICT II

P.O. Box Drawer DD, Artesia, NM 88210

DISTRICT III

1000 Rio Brazos Rd., Aztec, NM 87410

OIL CONSERVATION DIVISION

P.O. Box 2088

Santa Fe, New Mexico 87504-2088

WELL API NO.	30-025-20212
5. Indicate Type of Lease	STATE ☐ FEE ☒
6. State Oil / Gas Lease No.	
7. Lease Name or Unit Agreement Name	VACUUM GLORIETA WEST UNIT
8. Well No.	36
9. Pool Name or Wildcat	VACUUM GLORIETA
10. Elevation (Show whether DF, RKB, RT, GR, etc.)	3997' DF

SUNDRY NOTICES AND REPORTS ON WELLS
(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT (FORM C-101) FOR SUCH PROPOSALS.

1. Type of Well:	OIL WELL ☒ GAS WELL ☐ OTHER ☐
2. Name of Operator	TEXACO EXPLORATION & PRODUCTION INC.
3. Address of Operator	205 E. Bender, HOBBS, NM 88240
4. Well Location	Unit Letter <u>I</u> : <u>1650</u> Feet From The <u>SOUTH</u> Line and <u>790</u> Feet From The <u>EAST</u> Line Section <u>25</u> Township <u>17S</u> Range <u>34E</u> NMPM <u>LEA</u> COUNTY

11.

Check Appropriate Box to Indicate Nature of Notice, Report, or Other Data

NOTICE OF INTENTION TO:

PERFORM REMEDIAL WORK ☐ PLUG AND ABANDON ☐
TEMPORARILY ABANDON ☐ CHANGE PLANS ☐
PULL OR ALTER CASING ☐
OTHER: ☐

SUBSEQUENT REPORT OF:

REMEDIAL WORK ☒ ALTERING CASING ☐
COMMENCE DRILLING OPERATION ☐ PLUG AND ABANDONMENT ☐
CASING TEST AND CEMENT JOB ☐
OTHER: ☒ SQZ LOWER GLOR/PERF STIM UPPER GLOR

12. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

4-18-00: MIRU. NDWH. NUBOP. TIH W/BIT, DC'S ON TBG. TAG @ 5872'. DISP W/103 BRINE. DRILL TO 5892'.
4-19-00: LOWER TBG. TAG @ 5892'. C/O TO CIBP @ 5910'. DRILL CIBP & PSH TO 6200'. DRILL SCALE IRON SULFIDE, METAL TO 6204'.
4-20-00: TIH W/PKR TO 920'. NDBOP. CHANGE OUT WH. NUBOP. TIH W/MILL, DC'S & TBG TO 6204'. MILL TO 6211'.
4-21-00: LOWER TBG & TOOLS TO 6211'. TIH W/PKR, SN ON TBG. SET PKR @ 5904. LOAD & TEST BACKSIDE TO 500#.
4-24-00: TIH W/CMT RET ON TBG TO 5901'. PUMP THRU RET W/35 BFW. SET RET @ 5901. TESWT TBG TO 2000#-OK. SQZ GLORIETA PERFS W/100 SX CL C. TIH WBIT, DC'S ON TBG. STOP BIT @ 3455'.
4-25-00: TAG @ 5900'. DRILL 1' CMT TAG CMT RET. DRILL TO 5995'. TEST TO 500 PSI-OK. DISPL W/130 BBLs 2% KCL.
4-26-00: TIH W/PERF GUN. PERF GLORIETA FORM 5844-60, 5878-5946, 5952-60, 5970-84. TIH W/PKR, SN, TBG. SET PKR @ 5813'.
4-27-00: ACIDIZE GLORIETA PERFS 5844-5984 W/10,000 GALS 15% NEFE HCL ACID. RU SWAB. END FL @ 700'.
4-28-00: OPEN TO FRAC TANK. FL @ SURF. END FL @ 800'FR SURF.
5-01-00: REL PKR @ 5813'. TIH W/BIT, TBG TO 5812'.
5-02-00: TAG @ 5983'. C/O SALT TO 6000'. DRILL 30' CMT TO 6030'. CIRC CLN. TIH W/PKR, SN, TBG TO 5782'. SET PKR @ 5782'. LOAD/PSI CSG TO 500-OK.
5-03-00: TIH W/LOG TOOL. RUNH PUMP IN TRACER.REL PKR. TIH W/CMT RET TO 5775'. PUMP THRU RET. SET RET @ 5775'. TEST TBG TO 2000 PSI.
5-04-00: MIX 150 SX CL C CMT & 100 SX CL C NEAT. TIH W/BIT, DC'S & TBG TO 3326'.
5-05-00: TAG @ 5769'. DRILL 1' CMT. DRILL CMT RET @ 5770'. DRILL CMT 5770-5960' PBD. TEST TO 500 PSI. DISPL W/2% KCL WTR.
5-08-00: TIH W/PERF GUNS. PERF 5844-60, 5878-5946.
5-09-00: TIH W/PKR, SN, TBG. SET PKR @ 5813'. ACIDIZE GLORIETA PERFS 5844-5946 W/2000 GALS 15% NEFE ACID.
5-10-00: SWAB DRY. REL PKR. TIH & TAG @ 5945'. C/O 14' SALT FILL TO 9 PBD 5959'. RESET PKR @ 5813'.
5-11-00: NDBOP. NUWH.
5-12-00: RIG DOWN.
5-15-00: ON 24 HR OPT. WORKOVER UNSUCCESSFUL. SHUT-IN OIL. FINAL REPORT

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE J. Denise Leake TITLE Engineering Assistant DATE 6/26/00
TYPE OR PRINT NAME J. Denise Leake Telephone No. 397-0405

(This space for State Use)

APPROVED _____ DATE L
CONDITIONS OF APPROVAL IF ANY: _____ TITLE _____

