

DISTRICT I  
P.O. Box 1980, Hobbs, NM 88240

DISTRICT II  
P.O. Drawer DD, Artesia, NM 88210

DISTRICT III  
1000 Rio Brazos Rd., Aztec, NM 87410

**OIL CONSERVATION DIVISION**  
P.O. Box 2088  
Santa Fe, New Mexico 87504-2088

WELL API NO. <u>30-025-20234</u>
5. Indicate Type of Lease STATE <input type="checkbox"/> FEE <input checked="" type="checkbox"/>
6. State Oil & Gas Lease No.

<b>SUNDRY NOTICES AND REPORTS ON WELLS</b> (DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)	
1. Type of Well: OIL WELL <input checked="" type="checkbox"/> GAS WELL <input type="checkbox"/> OTHER <input type="checkbox"/>	7. Lease Name or Unit Agreement Name <u>Ora Jackson "A"</u>
2. Name of Operator <u>Big "6" Drilling Company</u>	8. Well No. <u>2</u>
3. Address of Operator <u>7500 San Felipe, Suite 666, Houston, TX 77063</u>	9. Pool name or Wildcat <u>Wildcat Queen</u>
4. Well Location Unit Letter <u>C</u> : <u>660</u> Feet From The <u>North</u> Line and <u>1980</u> Feet From The <u>West</u> Line Section <u>8</u> Township <u>19S</u> Range <u>35E</u> NMPM <u>Lea</u> County <u></u>	
10. Elevation (Show whether DF, RKB, RT, GR, etc.) <u>3867.3 GR</u>	

11. Check Appropriate Box to Indicate Nature of Notice, Report, or Other Data	
<b>NOTICE OF INTENTION TO:</b>	<b>SUBSEQUENT REPORT OF:</b>
PERFORM REMEDIAL WORK <input type="checkbox"/>	REMEDIAL WORK <input type="checkbox"/>
TEMPORARILY ABANDON <input type="checkbox"/>	ALTERING CASING <input type="checkbox"/>
PULL OR ALTER CASING <input type="checkbox"/>	COMMENCE DRILLING OPNS. <input type="checkbox"/>
OTHER: <input type="checkbox"/>	PLUG AND ABANDONMENT <input checked="" type="checkbox"/>
	CASING TEST AND CEMENT JOB <input type="checkbox"/>
	OTHER: <input type="checkbox"/>

12. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

1. Run 4 1/2" CIBP in hole & set @ 4480; cap with 10 sks. of cement.
2. Run tubing to 4044' and spot 25 sks. of cement. WOC and tagged @ 3912'.
3. Run tubing to 653' and spot 25 sks. of cement.
4. Pulled tubing to 466' and spot 60 sks. of cement. WOC and tagged @ 340'.
5. Spot 10 sks. of cement @ surface and install P & A marker.
6. Loaded hole with mud between all plugs.

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE Raymond Maldonado TITLE P & A Supervisor  
Baber Well Serv., Cementer DATE 8-18-89  
TYPE OR PRINT NAME Raymond Maldonado TELEPHONE NO. 505-393-5516

(This space for State Use)

APPROVED BY Lyle F. Turnascliff TITLE GAS INSPECTOR DATE AUG 17 1990  
CONDITIONS OF APPROVAL, IF ANY:

AUG 21 1989  
OCD  
HOBBS OFFICE