

Submit 3 Copies
to Appropriate
District Office

State of New Mexico
Energy Minerals and Natural Resources Department

Form C-103
Revised 1-1-89

DISTRICT I
P.O. Box 1980, Hobbs, NM 88240

DISTRICT II
P.O. Drawer DD, Artesia, NM 88210

DISTRICT III
1000 Rio Brazos Rd., Aztec, NM 87410

OIL CONSERVATION DIVISION
P.O. Box 2088
Santa Fe, New Mexico 87504-2088

WELL API NO. 30-025-20274
5. Indicate Type of Lease STATE ☒ FEE ☐
6. State Oil & Gas Lease No. B-155-1
7. Lease Name or Unit Agreement Name NEW MEXICO "O" STATE NCT-1
8. Well No. 18
9. Pool name or Wildcat VACUUM DRINKARD

SUNDRY NOTICES AND REPORTS ON WELLS
(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A
DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT"
(FORM C-101) FOR SUCH PROPOSALS.)

1. Type of Well: OIL WELL ☒ GAS WELL ☐ OTHER ☐	2. Name of Operator TEXACO E & P INC.
3. Address of Operator PO BOX 730; HOBBS, NEW MEXICO 88240	4. Well Location Unit Letter <u>H</u> : <u>1880</u> Feet From The <u>NORTH</u> Line and <u>560</u> Feet From The <u>EAST</u> Line Section <u>36</u> Township <u>17S</u> Range <u>34E</u> NMPM LEA County
10. Elevation (Show whether DF, RKB, RT, GR, etc.) 4005 (DF)	

11.

Check Appropriate Box to Indicate Nature of Notice, Report, or Other Data

NOTICE OF INTENTION TO:

SUBSEQUENT REPORT OF:

PERFORM REMEDIAL WORK ☐	PLUG AND ABANDON ☐	REMEDIAL WORK ☐	ALTERING CASING ☐
TEMPORARILY ABANDON ☐	CHANGE PLANS ☐	COMMENCE DRILLING OPNS. ☐	PLUG AND ABANDONMENT ☒
PULL OR ALTER CASING ☐		CASING TEST AND CEMENT JOB ☐	
OTHER: ☐		OTHER: ☐	

12. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

- 1) NOTIFY NMOCDF OF INTENT TO PLUG AND ABANDON WELL. NOTE THIS IS A TRIPLE COMPLETION WELL W/ STRINGS OF 2 7/8" TUB F/ CSG.
- 2) X STRING PSLV 06/19/95 20 SX CMT @ 7700' CAL TOC @ 6888'
- 3) 06/19/95 30 SX CMT @ 6600' CAL TOC @ 5382'
- 4) 06/19/95 30 SX CMT @ 4860' CAL TOC @ 3632' 9 5/8" SHOE PLUG
- 5) 06/19/95 10 SX CMT @ 3700' CAL TOC @ 3294'
- 6) 06/19/95 10 SX CMT @ 2860' CAL TOC @ 2454'
- 7) 06/19/95 20 SX CMT @ 1650' CAL TOC @ 838'
- 8) 06/19/95 15 SX CMT @ 400' TO 0' FRESH WATER PLUG
- 9) Y STRING WFMP 06/21/95 SET 2 7/8" CMT RET @ 7339' SQZ 45 SX CMT BELOW SHUT IN @ 1400 PSI CAP
- 10) 06/21/95 30 SX CMT @ 6600' CAL TOC @ 5382'
- 11) 06/21/95 30 SX CMT @ 4850' CAL TOC @ 3632' 9 5/8" SHOE PLUG
- 12) 06/21/95 10 SX CMT @ 3700' CAL TOC @ 3294'

(OVER)

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE

TITLE

DATE

TYPE OR PRINT NAME

TELEPHONE NO. 915-3555080

(THIS SPACE FOR TITLE USE)

APPROVED BY

TITLE

DATE

CONDITIONS OF APPROVAL, IF ANY:

SEP 07 1995

- 13) 06/21/95 10 SX CMT @ 2860' CAL TOC @ 2454'
- 14) 06/21/95 20 SX CMT @ 1650' CAL TOC @ 838'
- 15) 06/21/95 15 SX CMT @ 400' TO 0' FRESH AND SURF PLUG
- 16) Z STRING= ABO 06/22/95 TAG TOC @ 2588'
- 17) PERF 4JHF @ 1700' SQZ 100 SX CMT DOWN 2 7/8" CSG HAD FULL RETURNSS UP 9 5/8" X 2 7/8" DISP TOC TO 1300' TAG TOC NEXT DAY @ 1185'
- 18) 06/23/95 SPOT 15 SX SURF PLUG 400'-0'
- 19) 06/23/95 NIPPLE DOWN BOP & CUT OFF WELL HEAD; CAP WELL; INSTALL DRY HOLE MARKER
- 20) CLEAN UP LOCATION RIG DOWN & MOVE OFF.