

STATE OF NEW MEXICO
ENERGY AND MINERALS DEPARTMENT

NO. OF COPIES RECEIVED	
DISTRIBUTION	
SANTA FE	
FILE	
U.S.G.S.	
LAND OFFICE	
OPERATOR	

OIL CONSERVATION DIVISION
P. O. BOX 2088
SANTA FE, NEW MEXICO 87501

Form C-103
Revised 10-1-78

5a. Indicate Type of Lease
State ☐ Fee ☒

5. State Oil & Gas Lease No.

SUNDRY NOTICES AND REPORTS ON WELLS

DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR.
USE "APPLICATION FOR PERMIT -" (FORM C-101) FOR SUCH PROPOSALS.)

OIL WELL ☒ GAS WELL ☐ OTHER ☐

Name of Operator ARCO Oil and Gas Co.
Div of Atlantic Richfield Co.

Address of Operator
P. O. Box 1710, Hobbs, N M 88241-1710

Location of Well
UNIT LETTER K 1980 FEET FROM THE South LINE AND 1980 FEET FROM
THE West LINE, SECTION 5 TOWNSHIP 19S RANGE 35E NMPM.

7. Unit Agreement Name

8. Farm or Lease Name
Ora L. Jackson

9. Well No.
1

10. Field and Pool, or Wildcat
Scharb Bone Springs

15. Elevation (Show whether DF, RT, GR, etc.)
3894' DF

12. County
Lea

Check Appropriate Box To Indicate Nature of Notice, Report or Other Data

NOTICE OF INTENTION TO:

SUBSEQUENT REPORT OF:

PERFORM REMEDIAL WORK ☐
TEMPORARILY ABANDON ☐
PULL OR ALTER CASING ☐
OTHER ☐

PLUG AND ABANDON ☒
CHANGE PLANS ☐
OTHER ☐

REMEDIAL WORK ☐
COMMENCE DRILLING OPS. ☐
CASING TEST AND CEMENT JOBS ☐
OTHER ☐

ALTERING CASING ☐
PLUG AND ABANDONMENT ☐
OTHER ☐

Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

Propose to plug and abandon in the following manner:
Blowout Program Attached.

- Rig up, install BOP, RIH w/4-3/4" csg swage, bumper sub, jars to TO 5 1/2" csg stub @ 2395'. Attempt to swage out 5 1/2" csg. If unsuccessful, POH w/swage & run smaller swage, if unsuccessful w/swaging out 5 1/2" csg, POH w/swage & run 1" x 3 1/2" long tapered pilot mill, run 2-3/8" CS Hydril to btm & spot cmt plugs as follows:
10,156 - 9956' 200' plug
9256 - 9050' 200' plug
7000 - 6900 100' plug
3950 - 3850 100' plug
- If tapered mill is unsuccessful, then set 8-5/8" cmt retr 100' above 5 1/2" csg stub. Cmt sqz w/400 sx Cl C contg 2% CaCl₂, spot 10' cmt on top of cmt retr.
- Pull tbg up to 450', spot 100' cmt plug to 350'.
- Spot 10 sx cmt @ surf. Install dry hole marker, clean & level location for abandonment.

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNED Jerry D. Schmidt

TITLE Dist. Drlg. Supt.

DATE 2/26/82

ORIGINAL SIGNED BY

JERRY D. SCHMIDT

MAR 4 1982

APPROVED BY _____

TITLE _____

DATE _____

CONDITIONS OF APPROVAL, IF ANY: