SANTA FE FILE	NEW MEXICO OIL CONSERVATION	COMMISSION Effective 1-1-65	
U.\$.G.\$.		5a. Indicate Type of Lease	
LAND OFFICE		State X Fe	e
OPERATOR		5. State Oil & Gas Lease No.	
		E-5221	
SUNDRY NOTICES AND REPORTS ON WELLS (DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT -" (FORM C-101) FOR SUCH PROPOSALS.)		ERENT RESERVOIR.	
USE "APPLICAT	ION FOR PERMIT -** (FORM C-101) FOR SUCH PROPOSALS.	7. Unit Agreement Name	7777
OIL GAS WELL	OTHER-	7. Sink rigidelinent ivalile	
2. Name of Operator	NTV	8. Farm or Lease Name	
AZTEC OIL & GAS COMPA	NI	State VE	
P. O. Box 837, Hobbs,	New Mexico 88240	9. Well No.	
4. Location of Well		10. Field and Pool, or Wildcat	
UNIC LETTER J	1980 South LINE AND	1980 FEET FROM Vacuum (G-SA)	
THE LINE, SECTION	on 31 TOWNSHIP 17-S RANGE	NMPM.	
	15. Elevation (Show whether DF, RT, GR,	etc.) 12. County	1111
	3881 KB	Lea	
Check	Appropriate Box To Indicate Nature of N	otice. Report or Other Data	
	NTENTION TO:	SUBSEQUENT REPORT OF:	
	_	[_
PERFORM REMEDIAL WORK	PLUG AND ABANDON REMEDIAL W		<u>_</u>
TEMPORARILY ABANDON PULL OF ALTER CASING		RILLING OPNS. PLUG AND ABANDONME	NT X
	<u> </u>	AND CEMENT 1988	_
OTHER			
	perations (Clearly state all pertinent details, and give	pertinent dates, including estimated date of starting any pr	ronosa
17. Describe Proposed or Completed Op	1	processes acres, energying commercial date of starting any pr	oposce
work) SEE RULE 1103.			
work) SEE RULE 1103.	& Abandoned in the following ma	nner:	
This well was Plugged	& Abandoned in the following man	nner:	
This well was Plugged 1. Set C.I.B.P at 490	& Abandoned in the following ma	nner:	
This well was Plugged 1. Set C.I.B.P at 490 2. Loaded hole w/Brin	& Abandoned in the following man 00° with 1 sx cement. ne Water.	nner:	
This well was Plugged 1. Set C.I.B.P at 490 2. Loaded hole w/Brin 3. Set 25 sxs cement	& Abandoned in the following ma	nner:	
This well was Plugged 1. Set C.I.B.P at 490 2. Loaded hole w/Brin 3. Set 25 sxs cement 4. Set 25 sxs cement 5. Loaded Hole wSalt	& Abandoned in the following max 00' with 1 sx cement. ne Water. plug at 4300-4400' (Queen). plug at 3350-3450' (Yates).	nner:	
This well was Plugged 1. Set C.I.B.P at 490 2. Loaded hole w/Brin 3. Set 25 sxs cement 4. Set 25 sxs cement 5. Loaded Hole wSalt 6. Set 25 sxs cement	& Abandoned in the following man 00' with 1 sx cement. ne Water. plug at 4300-4400' (Queen). plug at 3350-3450' (Yates). Base Mud. plug at 1950-2050' (Top Salt).		
This well was Plugged 1. Set C.I.B.P at 490 2. Loaded hole w/Brin 3. Set 25 sxs cement 4. Set 25 sxs cement 5. Loaded Hole wSalt 6. Set 25 sxs cement 7. Shot casing at 120	& Abandoned in the following man 00' with 1 sx cement. ne Water. plug at 4300-4400' (Queen). plug at 3350-3450' (Yates). Base Mud. plug at 1950-2050' (Top Salt). 00', could not pull. Shot casing	g at 375' and Pulled.	
This well was Plugged 1. Set C.I.B.P at 490 2. Loaded hole w/Brin 3. Set 25 sxs cement 4. Set 25 sxs cement 5. Loaded Hole wSalt 6. Set 25 sxs cement 7. Shot casing at 120 8. Set 45 sxs cement	& Abandoned in the following man 00' with 1 sx cement. ne Water. plug at 4300-4400' (Queen). plug at 3350-3450' (Yates). Base Mud. plug at 1950-2050' (Top Salt). 00', could not pull. Shot casing plug at 275-375' in and out Sur	g at 375' and Pulled. Face casing and in Stub of 5½" casi	ng.
This well was Plugged 1. Set C.I.B.P at 490 2. Loaded hole w/Brin 3. Set 25 sxs cement 4. Set 25 sxs cement 5. Loaded Hole wSalt 6. Set 25 sxs cement 7. Shot casing at 120 8. Set 45 sxs cement	& Abandoned in the following man 00' with 1 sx cement. ne Water. plug at 4300-4400' (Queen). plug at 3350-3450' (Yates). Base Mud. plug at 1950-2050' (Top Salt). 00', could not pull. Shot casing	g at 375' and Pulled. Face casing and in Stub of 5½" casi	ng.
This well was Plugged 1. Set C.I.B.P at 490 2. Loaded hole w/Brin 3. Set 25 sxs cement 4. Set 25 sxs cement 5. Loaded Hole wSalt 6. Set 25 sxs cement 7. Shot casing at 120 8. Set 45 sxs cement	& Abandoned in the following man 00' with 1 sx cement. ne Water. plug at 4300-4400' (Queen). plug at 3350-3450' (Yates). Base Mud. plug at 1950-2050' (Top Salt). 00', could not pull. Shot casing plug at 275-375' in and out Sur	g at 375' and Pulled. Face casing and in Stub of 5½" casi	ng.
This well was Plugged 1. Set C.I.B.P at 490 2. Loaded hole w/Brin 3. Set 25 sxs cement 4. Set 25 sxs cement 5. Loaded Hole wSalt 6. Set 25 sxs cement 7. Shot casing at 120 8. Set 45 sxs cement	& Abandoned in the following man 00' with 1 sx cement. ne Water. plug at 4300-4400' (Queen). plug at 3350-3450' (Yates). Base Mud. plug at 1950-2050' (Top Salt). 00', could not pull. Shot casing plug at 275-375' in and out Sur	g at 375' and Pulled. Face casing and in Stub of 5½" casi	ng.
This well was Plugged 1. Set C.I.B.P at 490 2. Loaded hole w/Brin 3. Set 25 sxs cement 4. Set 25 sxs cement 5. Loaded Hole wSalt 6. Set 25 sxs cement 7. Shot casing at 120 8. Set 45 sxs cement	& Abandoned in the following man 00' with 1 sx cement. ne Water. plug at 4300-4400' (Queen). plug at 3350-3450' (Yates). Base Mud. plug at 1950-2050' (Top Salt). 00', could not pull. Shot casing plug at 275-375' in and out Sur	g at 375' and Pulled. Face casing and in Stub of 5½" casi	ng.
This well was Plugged 1. Set C.I.B.P at 490 2. Loaded hole w/Brin 3. Set 25 sxs cement 4. Set 25 sxs cement 5. Loaded Hole wSalt 6. Set 25 sxs cement 7. Shot casing at 120 8. Set 45 sxs cement	& Abandoned in the following man 00' with 1 sx cement. ne Water. plug at 4300-4400' (Queen). plug at 3350-3450' (Yates). Base Mud. plug at 1950-2050' (Top Salt). 00', could not pull. Shot casing plug at 275-375' in and out Sur	g at 375' and Pulled. Face casing and in Stub of 5½" casi	ng.
This well was Plugged 1. Set C.I.B.P at 490 2. Loaded hole w/Brin 3. Set 25 sxs cement 4. Set 25 sxs cement 5. Loaded Hole wSalt 6. Set 25 sxs cement 7. Shot casing at 120 8. Set 45 sxs cement	& Abandoned in the following man 00' with 1 sx cement. ne Water. plug at 4300-4400' (Queen). plug at 3350-3450' (Yates). Base Mud. plug at 1950-2050' (Top Salt). 00', could not pull. Shot casing plug at 275-375' in and out Sur	g at 375' and Pulled. Face casing and in Stub of 5½" casi	ng.
This well was Plugged 1. Set C.I.B.P at 490 2. Loaded hole w/Brin 3. Set 25 sxs cement 4. Set 25 sxs cement 5. Loaded Hole wSalt 6. Set 25 sxs cement 7. Shot casing at 120 8. Set 45 sxs cement	& Abandoned in the following man 00' with 1 sx cement. ne Water. plug at 4300-4400' (Queen). plug at 3350-3450' (Yates). Base Mud. plug at 1950-2050' (Top Salt). 00', could not pull. Shot casing plug at 275-375' in and out Sur	g at 375' and Pulled. Face casing and in Stub of 5½" casi	ng.
This well was Plugged 1. Set C.I.B.P at 490 2. Loaded hole w/Brin 3. Set 25 sxs cement 4. Set 25 sxs cement 5. Loaded Hole wSalt 6. Set 25 sxs cement 7. Shot casing at 120 8. Set 45 sxs cement 9. Set 10 sxs cement	& Abandoned in the following man 00' with 1 sx cement. ne Water. plug at 4300-4400' (Queen). plug at 3350-3450' (Yates). Base Mud. plug at 1950-2050' (Top Salt). 00', could not pull. Shot casing plug at 275-375' in and out Surrent plug w/Dry Hole Marker, leveled	g at 375' and Pulled. face casing and in Stub of 5½" casi and cleared location.	ng.
This well was Plugged 1. Set C.I.B.P at 490 2. Loaded hole w/Brin 3. Set 25 sxs cement 4. Set 25 sxs cement 5. Loaded Hole wSalt 6. Set 25 sxs cement 7. Shot casing at 120 8. Set 45 sxs cement 9. Set 10 sxs cement	& Abandoned in the following man 00' with 1 sx cement. ne Water. plug at 4300-4400' (Queen). plug at 3350-3450' (Yates). Base Mud. plug at 1950-2050' (Top Salt). 00', could not pull. Shot casing plug at 275-375' in and out Sur	g at 375' and Pulled. face casing and in Stub of 5½" casi and cleared location.	ng.
This well was Plugged 1. Set C.I.B.P at 490 2. Loaded hole w/Brin 3. Set 25 sxs cement 4. Set 25 sxs cement 5. Loaded Hole wSalt 6. Set 25 sxs cement 7. Shot casing at 120 8. Set 45 sxs cement 9. Set 10 sxs cement orginial signed by:	& Abandoned in the following man OO' with 1 sx cement. ne Water. plug at 4300-4400' (Queen). plug at 3350-3450' (Yates). Base Mud. plug at 1950-2050' (Top Salt). OO', could not pull. Shot casing plug at 275-375' in and out Surplug w/Dry Hole Marker, leveled	g at 375' and Pulled. face casing and in Stub of $5\frac{1}{2}$ " casi and cleared location.	ng.
This well was Plugged 1. Set C.I.B.P at 490 2. Loaded hole w/Brin 3. Set 25 sxs cement 4. Set 25 sxs cement 5. Loaded Hole wSalt 6. Set 25 sxs cement 7. Shot casing at 120 8. Set 45 sxs cement 9. Set 10 sxs cement	& Abandoned in the following man 00' with 1 sx cement. ne Water. plug at 4300-4400' (Queen). plug at 3350-3450' (Yates). Base Mud. plug at 1950-2050' (Top Salt). 00', could not pull. Shot casing plug at 275-375' in and out Surrent plug w/Dry Hole Marker, leveled	g at 375' and Pulled. face casing and in Stub of $5\frac{1}{2}$ " casi and cleared location.	ng.
This well was Plugged 1. Set C.I.B.P at 490 2. Loaded hole w/Brin 3. Set 25 sxs cement 4. Set 25 sxs cement 5. Loaded Hole wSalt 6. Set 25 sxs cement 7. Shot casing at 120 8. Set 45 sxs cement 9. Set 10 sxs cement	& Abandoned in the following man OO' with 1 sx cement. ne Water. plug at 4300-4400' (Queen). plug at 3350-3450' (Yates). Base Mud. plug at 1950-2050' (Top Salt). OO', could not pull. Shot casing plug at 275-375' in and out Surplug w/Dry Hole Marker, leveled	g at 375' and Pulled. face casing and in Stub of $5\frac{1}{2}$ " casi and cleared location.	ng.
This well was Plugged 1. Set C.I.B.P at 490 2. Loaded hole w/Brin 3. Set 25 sxs cement 4. Set 25 sxs cement 5. Loaded Hole wSalt 6. Set 25 sxs cement 7. Shot casing at 120 8. Set 45 sxs cement 9. Set 10 sxs cement	& Abandoned in the following man OO' with 1 sx cement. ne Water. plug at 4300-4400' (Queen). plug at 3350-3450' (Yates). Base Mud. plug at 1950-2050' (Top Salt). OO', could not pull. Shot casing plug at 275-375' in and out Surplug w/Dry Hole Marker, leveled	g at 375' and Pulled. face casing and in Stub of $5\frac{1}{2}$ " casi and cleared location.	ng.