

Submit 3 Copies
to Appropriate
District Office

State of New Mexico
Energy, Minerals and Natural Resources Department

Form C-103
Revised 1-1-89

DISTRICT I
P.O. Box 1980, Hobbs, NM 88240

DISTRICT II
P.O. Drawer DD, Artesia, NM 88210

DISTRICT III
1000 Rio Brazos Rd., Aztec, NM 87410

OIL CONSERVATION DIVISION
P.O. Box 2088
Santa Fe, New Mexico 87504-2088

WELL API NO. <u>30-025-20394</u>
5. Indicate Type of Lease STATE <input type="checkbox"/> FEE <input checked="" type="checkbox"/>
6. State Oil & Gas Lease No.
7. Lease Name or Unit Agreement Name <u>Ora Jackson "A"</u>
8. Well No. <u>1</u>
9. Pool name or Wildcat <u>Scharh Bone Springs</u>

SUNDRY NOTICES AND REPORTS ON WELLS (DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)	
1. Type of Well: OIL WELL <input checked="" type="checkbox"/> GAS WELL <input type="checkbox"/> OTHER <u>Land</u>	
2. Name of Operator <u>Big "6" Drilling Company</u>	
3. Address of Operator <u>7500 San Felipe, Suite 66, Houston, TX 77063</u>	
4. Well Location Unit Letter <u>M</u> : <u>660</u> Feet From The <u>South</u> Line and <u>660</u> Feet From The <u>West</u> Line Section <u>5</u> Township <u>19S</u> Range <u>35E</u> NMPM Lea County 10. Elevation (Show whether DF, RKB, RT, GR, etc.) <u>3872 GL</u>	

11. Check Appropriate Box to Indicate Nature of Notice, Report, or Other Data	
NOTICE OF INTENTION TO:	SUBSEQUENT REPORT OF:
PERFORM REMEDIAL WORK <input type="checkbox"/>	REMEDIAL WORK <input type="checkbox"/>
TEMPORARILY ABANDON <input type="checkbox"/>	ALTERING CASING <input type="checkbox"/>
PULL OR ALTER CASING <input type="checkbox"/>	COMMENCE DRILLING OPNS. <input type="checkbox"/>
OTHER: <input type="checkbox"/>	PLUG AND ABANDONMENT <input checked="" type="checkbox"/>
	CASING TEST AND CEMENT JOB <input type="checkbox"/>
	OTHER: <input type="checkbox"/>

12. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.
1. Run rubing to 8030' and spot 150 sks. of cement.
 2. Pulled tubing to 7400' and spot 50 sks. of cement. WOC and tagged @ 7113'.
 3. Pulled tubing to 7000' and spot 25 sks. of cement.
 4. Cut and pull 4 1/2" casing @ 6000'.
 5. Run tubing to 6050' and spot 25 sks. of cement. WOC and tagged @ 5940'.
 6. Pulled tubing to 4030' and spot 30 sks. of cement. WOC and tagged @ 3909'.
 7. Run tubing to 450' and spot 75 sks. of cement. WOC and tagged @ 300'.
 8. Spot 10 sk. surface plug and install P & A marker.
 9. Hole was loaded with mud between all plugs.

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE <u>Raymond Maldonado</u>	P & A Supervisor
TYPE OR PRINT NAME <u>Raymond Maldonado</u>	TITLE <u>Baber Well Serv., Cementer</u>
	DATE <u>8-18-89</u>
	TELEPHONE NO. <u>505-393-5516</u>

(This space for State Use)

APPROVED BY R. A. Salas OIL & GAS INSPECTOR SEP 12 1989

CONDITIONS OF APPROVAL, IF ANY: