

Submit 3 Copies
to Appropriate
District Office

State of New Mexico
Energy, Minerals and Natural Resources Department

Form C-103
Revised 1-1-89

DISTRICT I
P.O. Box 1980, Hobbs, NM 88240

OIL CONSERVATION DIVISION
P.O. Box 2088
Santa Fe, New Mexico 87504-2088

DISTRICT II
P.O. Drawer DD, Artesia, NM 88210

DISTRICT III
1000 Rio Brazos Rd., Aztec, NM 87410

WELL API NO.
30-025-20946

5. Indicate Type of Lease
STATE FEE

6. State Oil & Gas Lease No. B-155

SUNDRY NOTICES AND REPORTS ON WELLS
(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A
DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT"
(FORM C-101) FOR SUCH PROPOSALS.)

7. Lease Name or Unit Agreement Name
New Mexico "0" State
NCT-1

1. Type of Well:
OIL WELL GAS WELL OTHER

8. Well No. 24

2. Name of Operator
Texaco Exploration and Production Inc.

3. Address of Operator
P.O. Box 730 Hobbs, New Mexico 88240

9. Pool name or Wildcat
Vacuum Glorieta, Wolfcamp, Abo
NORTH

4. Well Location
Unit Letter P : 860 Feet From The South Line and 660 Feet From The East Line
Section 36 Township 17-S Range 34-E NMPM Lea County

10. Elevation (Show whether DF, RKB, RT, GR, etc.)
3994' DF

11. Check Appropriate Box to Indicate Nature of Notice, Report, or Other Data

NOTICE OF INTENTION TO:		SUBSEQUENT REPORT OF:	
PERFORM REMEDIAL WORK <input type="checkbox"/>	PLUG AND ABANDON <input type="checkbox"/>	REMEDIAL WORK <input type="checkbox"/>	ALTERING CASING <input type="checkbox"/>
TEMPORARILY ABANDON <input type="checkbox"/>	CHANGE PLANS <input type="checkbox"/>	COMMENCE DRILLING OPNS. <input type="checkbox"/>	PLUG AND ABANDONMENT <input checked="" type="checkbox"/>
PULL OR ALTER CASING <input type="checkbox"/>		CASING TEST AND CEMENT JOB <input type="checkbox"/>	
OTHER: <input type="checkbox"/>		OTHER: <input type="checkbox"/>	

12. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

5/13/92 - 6/23/92
Casing Strings: X - Abo, Y - Wolfcamp, Z - Glorieta
1. Notified NMOCD, MIRU w/P&A equip. Starting date 5/13/92.
2. Fished string of stuck 1" Kobe tbg in Y csg string, C/O to 10,025'.
3. C/O X csg string to 9240'. C/O Z csg string to 6355'.
4. In Y string set CIBP @ 9990', capped w/ 35' cmt. In X string set CIBP @ 9080', capped w/ 35' cmt.
5. Loaded both X & Y strings w/ brine gel mud. X string went on vacuum, isolated csg leak fr 5850'-6150'.
6. In Y string set CIBP's @ 5850' & 4418', capped plugs w/ 35' cmt.
(CONTINUED ON BACK)

I hereby certify that the information above is true and complete to the best of my knowledge and belief.
SIGNATURE M.C. Duncan TITLE Engineer's Assistant DATE 6-26-92
TYPE OR PRINT NAME M.C. Duncan TELEPHONE NO. 393-7191

(This space for State Use)
APPROVED BY [Signature] TITLE OIL & GAS INSPECTOR DATE OCT 22 '92
CONDITIONS OF APPROVAL, IF ANY:

7. Ran freepoint on Y string, free @ 600'. Perf Y string @ 2691' & 2284', could not est circ to surf. Perf @ 1597', established circ to surf. In Y string, set CIBP @ 2600', capped w/ 35' cmt. Pmped cmt dn Y string until circ to surf thru perfs @ 1597'.
8. Attempted to pump cmt dn the X & Z strings, both pressured up & held 3000#. Tagged cmt in X string @ 113', D/O to 1113', tstd csg to 1000#, OK. Tagged cmt in Z string @ 2000', D/O to 3065', tstd csg to 1000#, OK.
9. In Z string set CIBP's @ 2800' & 1534', capped plugs w/ 35' cmt. Then set cmt plug fr 50' to surf. In X string, set cmt plug fr 50' to surf.
10. Cut off wellhead, installed dry hole marker, cleaned location. Completion date 6-23-92.