

STATE OF NEW MEXICO
ENERGY AND MINERALS DEPARTMENT

NO. OF COPIES RECEIVED	
DISTRIBUTION	
SANTA FE	
FILE	
U.S.G.S.	
LAND OFFICE	
OPERATOR	

OIL CONSERVATION DIVISION
P. O. BOX 2088
SANTA FE, NEW MEXICO 87501

Form C-103
Revised 10-1-78

5a. Indicate Type of Lease
State ☒ Fee ☐

5. State Oil & Gas Lease No.
B-155

SUNDRY NOTICES AND REPORTS ON WELLS

(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR.
USE "APPLICATION FOR PERMIT -" (FORM C-101) FOR SUCH PROPOSALS.)

1. OIL WELL ☒ GAS WELL ☐ OTHER ☐	7. Unit Agreement Name
2. Name of Operator TEXACO Inc.	8. Farm or Lease Name N.M. '0' St. NCT-1
3. Address of Operator P. O. Box 726, Hobbs, New Mexico 88240	9. Well No. 24
4. Location of Well UNIT LETTER P 860 FEET FROM THE South LINE AND 660 FEET FROM THE East LINE, SECTION 36 TOWNSHIP 17-S RANGE 34-E NMPM.	10. Field and Pool, or Wildcat Vacuum Glorieta
15. Elevation (Show whether DF, RT, GR, etc.) 3994' (DF)	12. County Lea

16. Check Appropriate Box To Indicate Nature of Notice, Report or Other Data
NOTICE OF INTENTION TO:

PERFORM REMEDIAL WORK ☐
TEMPORARILY ABANDON ☐
PULL OR ALTER CASING ☐

PLUG AND ABANDON ☐
CHANGE PLANS ☐

OTHER Addl. Glorieta Perfs. & Treat ☒

SUBSEQUENT REPORT OF:

REMEDIAL WORK ☐
COMMENCE DRILLING OPNS. ☐
CASING TEST AND CEMENT JOBS ☐
OTHER ☐

ALTERING CASING ☐
PLUG AND ABANDONMENT ☐

17. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

1. Rig up. Pull rods & pump. Install BOP. Pull Glorieta 2 1/16" tubing.
2. Set CIBP in Abo string @ 9100' & cap w/30' Cement. Set CIBP in Abo & Glorieta strings @ 6330' & cap w/30' Cement.
3. Set pkr @ 5900' in Glorieta. Acidize perfs. 5942'-6102' w/6000 gals. 20% NE HCL Acid in 4-stages (equal) using 300# rock salt between stages.
4. Perforate Glorieta string w/2-JSPF @ 6137', 41, 46, 51, 54, 57, & 6173'.
5. Set pkr. @ 6120'. Acidize perfs 6137'-6173' w/2000 gals 20% NE HCL Acid 2-stages using 150# rock salt between stages. Flush w/Brine.
6. Perforate Abo string w/2-JSPF from 6191'-6200'.
7. Install pumping equipment. Test & return to production.

18. I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNED Jerry Sexton

TITLE Asst. Dist. Mgr.

DATE 7-6-83

ORIGINAL SIGNED BY JERRY SEXTON
DISTRICT SUPERVISOR

APPROVED BY _____

TITLE _____

DATE _____

CONDITIONS OF APPROVAL, IF ANY:

JUL 11 1983

RE

RECEIVED

JUL 8 1983

OF
HOBBS OFFICE