

OIL CONSERVATION DIVISION

P. O. BOX 2088  
SANTA FE, NEW MEXICO 87501

Form C-103  
Revised 10-1-78

NO. OF COPIES RECEIVED	
DISTRIBUTION	
SANTA FE	
FILE	
U.S.G.S.	
LAND OFFICE	
OPERATOR	

5a. Indicate Type of Lease  
State ☒ Fee ☐  
5. State Oil & Gas Lease No.  
**E-7585**

SUNDRY NOTICES AND REPORTS ON WELLS

(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR.  
USE "APPLICATION FOR PERMIT TO DRILL" (FORM C-101) FOR SUCH PROPOSALS.)

1. OIL WELL <input checked="" type="checkbox"/> GAS WELL <input type="checkbox"/> OTHER <input type="checkbox"/>	7. Unit Agreement Name -
2. Name of Operator <b>TEXACO Inc.</b>	8. Farm or Lease Name <b>N.M. 'CG' St. NCT-2</b>
3. Address of Operator <b>P. O. Box 728, Hobbs, New Mexico 88240</b>	9. Well No. <b>1</b>
4. Location of Well UNIT LETTER <b>F</b> <b>1750</b> FEET FROM THE <b>West</b> LINE AND <b>2310</b> FEET FROM THE <b>North</b> LINE, SECTION <b>29</b> TOWNSHIP <b>17-S</b> RANGE <b>35-E</b> N.M.P.M.	10. Field and Pool, or Wildcat <b>Vacuum Glorieta</b>
15. Elevation (Show whether DF, RT, GR, etc.) <b>3978' (DF)</b>	12. County <b>Lea</b>

Check Appropriate Box To Indicate Nature of Notice, Report or Other Data  
NOTICE OF INTENTION TO: SUBSEQUENT REPORT OF:

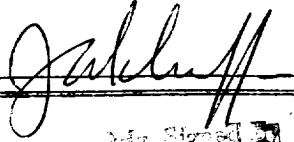
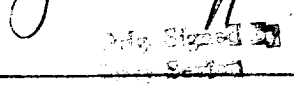
PERFORM REMEDIAL WORK <input type="checkbox"/>	PLUG AND ABANDON <input type="checkbox"/>	REMEDIAL WORK <input type="checkbox"/>	ALTERING CASING <input type="checkbox"/>
TEMPORARILY ABANDON <input type="checkbox"/>	CHANGE PLANS <input type="checkbox"/>	COMMENCE DRILLING OPNS. <input type="checkbox"/>	PLUG AND ABANDONMENT <input type="checkbox"/>
PULL OR ALTER CASING <input type="checkbox"/>	OTHER <input checked="" type="checkbox"/> <b>Repair Water flow @ wellhead</b>	CASING TEST AND CEMENT JOBS <input type="checkbox"/>	

17. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

1. Rig up. Pull rods & pump. Install BOP. Pull 2 1/16" tubing.
2. Set RBP @ approx. 5000'.
3. Log well.
4. Squeeze 11 3/4" - 2 7/8" Csg Annulus w/925 sx. Class 'C' cement. Re-log well. WOC & clean out.
5. Pull RBP. Set pkr. @ 6000'. Acidize Glorieta Perfs. 6151' - 6177' w/6000 gal. 20% NE- Fe Acid in 3-equal stages using rock salt & Benzoic Acid Flakes between stages. Flush w/2% KCL Water.
6. Run production equipment. Test & return to production.

THIS DOCUMENT IS THE PROPERTY OF THE STATE OF NEW MEXICO  
IT IS LOANED TO YOU BY THE STATE OF NEW MEXICO  
IT IS NOT TO BE REPRODUCED OR COPIED IN ANY MANNER

18. I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNED 	TITLE <b>Asst. Dist. Supt.</b>	DATE <b>4-22-80</b>
APPROVED BY 	TITLE	DATE <b>APR 22 1980</b>
CONDITIONS OF APPROVAL, IF ANY:		