Submit 3 Copies To Appropriate District State of New Mexico Form C-103 Office Energy, Minerals and Natural Resources Revised March 25, 1999 District I WELL API NO. 1625 N. French Dr., Hobbs, NM 87240 District II 30-025-20962 OIL CONSERVATION DIVISION 811 South First, Artesia, NM 87210 5. Indicate Type of Lease 2040 South Pacheco District III 1000 Rio Brazos Rd., Aztec, NM 87410 STATE X Santa Fe, NM 87505 FEE \square District IV 2040 South Pacheco, Santa Fe, NM 87505 6. State Oil & Gas Lease No. B-1030-1 SUNDRY NOTICES AND REPORTS ON WELLS 7. Lease Name or Unit Agreement Name: (DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.) Texaco-Mobil State Com. 1. Type of Well: Oil Well **x** Gas Well Other 2. Name of Operator 8. Well No. Prize Operating Company 3. Address of Operator 9. Pool name or Wildcat 3500 William D. Tate, Suite 200, Grapevine, Texas 76051 Vacuum, Abo N/Upper Penn/Wolfcamp 4. Well Location 2080 North feet from the 560 line and feet from the East line Section Township NMPM 17S Range 34E County Lea 10. Elevation (Show whether DR, RKB, RT, GR, etc.) 3986' GR 11. Check Appropriate Box to Indicate Nature of Notice, Report, or Other Data NOTICE OF INTENTION TO: SUBSEQUENT REPORT OF: PERFORM REMEDIAL WORK PLUG AND ABANDON REMEDIAL WORK ALTERING CASING TEMPORARILY ABANDON CHANGE PLANS COMMENCE DRILLING OPNS. PLUG AND **ABANDONMENT** PULL OR ALTER CASING MULTIPLE CASING TEST AND COMPLETION **CEMENT JOB** OTHER: OTHER: 12. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work). SEE RULE 1103. For Multiple Completions: Attach wellbore diagram of proposed completion or recompilation. Prize Operating Company respectfully request approval to Plug & Abandon the above mention well. Please find attached well schematic and plugging procedure for your review and approval. THE COMMISSION MUST BE NOTIFIED 24 HOURS PRIOR TO THE BEGINNING OF PLUGGING OPERATIONS FOR THE CHOS TO BE APPROVED. I hereby certify that the information above is true and complete to the best of my knowledge and belief SIGNATURE. TITLE Regulatory Analyst

TITLE

Type or print name **Don Aldridge**

(This space for State use)

Conditions of approval, if any:

APPROVED BY_

m


817-424-0454

Telephone No.

Texaco-Mobil State #1 Plug and Abandon

Procedure:

- 1. MIRU Workover Rig. Blow down all three 2 7/3" production strings.
- Penn String: Rig up wireline and RIH with guage ring to 10,000'. RIH with 2 7/8" CIBP and set at 10,000'. Dump bail 20' cement On top.
- 3. Wolfcamp String: Rig up wireline and RIH with guage ring to 9600'. RIH with 2 7/8" CIBP and set at 9600'. Dump bail 20' cement.
- 4. Abo String: Rig up wireline and RIH with guage ring to 9050'. RIH with 2 7/8" CIBP and set at 9050'. Dump bail 20' cement.
- 5. Perform stretch and free point on all 3-2 7/8" strings. Cut and Lay down strings at 4900' if possible. Stand one sting back And RIH to 4900' and circulate hole with 9.5# salt gel mud.
- 6. Mix and pump 200' plug (100' in and 100' out) at 9 5/8" casing shoe.
- 7. Pump a 30 sack cement surface plug from 63'-3'.
- 8. Dig out and cut off well head 3' below ground level. Weld %" steel Plate on top of casing.
- 9. RDMO. Clean location.

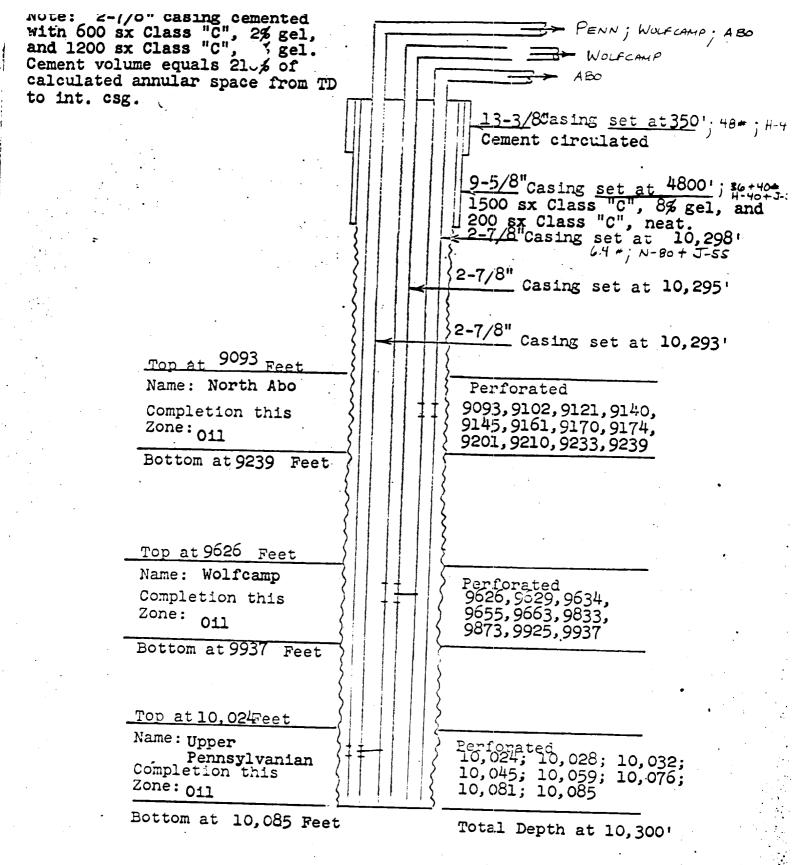

LEASE: TEXACO-Mobil "State" Well No. 1
FIELD: Vacuum (North Abo, Wolfcamp and Upper Pennsylvanian
DATE: July 31, 1964 COMPLETED

SEC. 25: T/75: R 346 2000 FEL 1 5000 FEL

BEC. 25; T175; R 34E; 2080 FSL + 560' FEL LEA COUNTY, NM