

Hondo "B" State #1
560' FSL & 1880' FEL
Sec. 6-19S-35E
Lea County, New Mexico

Plug and Abandon
WO No. NP-377

*Notify the New Mexico Oil Conservation Division District I
Office at (505) 393-6161.

1. Run GR/JB to 10,080'. Set CIBP at 10,070'.
2. Set CIBP at 9520'. Dump bail 35' of cement on top.
3. Load hole with mud laden fluid. Set balanced 100' plug (25 sx) through production tubing from 7800'-7700'.
4. Set balanced 100' plug (25 sx) through production tubing from 5150'-5050'.
5. Cut and pull 5-1/2" casing from 3950'.
6. Set plug in cut-off stub, 50' inside and 50' outside.
7. Set balanced plug (100 sx) from 3350'-3150'.
8. Set balanced plug (100 sx) from 2160'-1980'.
9. Set 100' plug (35 sx) back to surface.
10. Cut off wellhead. Make steel marker with:
Operator name, well name and number, section,
township and range.

RECEIVED

MAY 19 1988

DDO
HOBBS OFFICE