

STATE OF NEW MEXICO
ENERGY AND MINERALS DEPARTMENT

OIL CONSERVATION DIVISION
P. O. BOX 2088
SANTA FE, NEW MEXICO 87501

Form C-103
Revised 10-1-78

NO. OF COPIES RECEIVED	
DISTRIBUTION	
SANTA FE	
FILE	
U.S.G.S.	
LAND OFFICE	
OPERATOR	

5a. Indicate Type of Lease	
State ☒	Fee ☐
5. State Oil & Gas Lease No. B-155	

SUNDRY NOTICES AND REPORTS ON WELLS
DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR.
USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.

1. OIL WELL ☒ GAS WELL ☐ OTHER ☐		7. Unit Agreement Name
2. Name of Operator Texaco Producing Inc.		8. Farm or Lease Name N.M. "O" State Nct-1
3. Address of Operator P.O. Box 728, Hobbs, New Mexico 88240		9. Well No. 25
4. Location of Well UNIT LETTER <u>J</u> <u>2090</u> FEET FROM THE <u>South</u> LINE AND <u>2086</u> FEET FROM THE <u>East</u> LINE, SECTION <u>36</u> TOWNSHIP <u>17S</u> RANGE <u>34E</u> N.M.P.M.		10. Field and Pool, or Whdcat Vacuum Glorieta
15. Elevation (Show whether DF, RT, GR, etc.) 3990 (GR)		12. County Lea

Check Appropriate Box To Indicate Nature of Notice, Report or Other Data
NOTICE OF INTENTION TO: SUBSEQUENT REPORT OF:

PERFORM REMEDIAL WORK ☐	PLUG AND ABANDON ☐	REMEDIAL WORK ☒	ALTERING CASING ☐
TEMPORARILY ABANDON ☐	CHANGE PLANS ☐	COMMENCE DRILLING OPNS. ☐	PLUG AND ABANDONMENT ☐
PULL OR ALTER CASING ☐	OTHER ☐	CASING TEST AND CEMENT JOBS ☐	

17. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

1. MIRU. Pull rods and pump. Install BOP. Pull tubing.
2. THH with 3-7/8" bit to 6185'. POH.
3. Perforate Glorieta 2 SPI at 6131, 33, 39, 43, 48, 50, 52, 57, 6160' (9 intervals, 18 shots).
4. Set packer at 6105'. Acidize perforations at 6131-60' with 2000 gals 20% NEFE and 24 ball sealers. AIR 3 BPM, Max Pressure 2200 psi, ISIP O.
5. Reset packer at 5659'. Run pump-in tracer and temperature survey at 5900-6174'.
6. Acidize Glorieta perforations at 5930'-6160' with 10,000 gals gelled 20% NEFE and 3000 lbs rock salt in five stages. AIR 6.5 BPM, Max P 1050 psi, ISIP O.
7. Released packer. Washed out salt at 6130-6185'. POH.
8. Run production equipment, remove BOP, and return to production. 24 hour OPT 7-14-87: 25 BO, 60 BW, gravity 38, GOR 4732. Test prior to workover: 3 BO, 6 BW.

18. I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNED A. Gernandt 393-4031 TITLE Area Superintendent DATE JUL 27 1987

ORIGINAL SIGNED BY JERRY SEXTON
DISTRICT I SUPERVISOR

APPROVED BY _____

TITLE _____

DATE _____

CONDITIONS OF APPROVAL, IF ANY:

RECEIVED
JUL 27 1987
OCD
HOBBS OFFICE