

Submit 3 Copies
to Appropriate
District Office

State of New Mexico
Energy, Minerals and Natural Resources Department

1
R
3
-89

DISTRICT I
P.O. Box 1980, Hobbs, NM 88240

DISTRICT II
P.O. Drawer DD, Artesia, NM 88210

DISTRICT III
1000 Rio Brazos Rd., Aztec, NM 87410

OIL CONSERVATION DIVISION
P.O. Box 2088
Santa Fe, New Mexico 87504-2088

WELL API NO. 3002521663
5. Indicate Type of Lease STATE ☒ FEE ☐
6. State Oil & Gas Lease No. 011122
7. Lease Name or Unit Agreement Name Central Vacuum Unit
8. Well No. 12
9. Pool name or Wildcat Vacuum Grayburg San Andres
10. Elevation (Show whether DF, RKB, RT, GR, etc.) 3991' (GR)

SUNDRY NOTICES AND REPORTS ON WELLS
(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A
DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT"
(FORM C-101) FOR SUCH PROPOSALS.)

1. Type of Well: OIL WELL ☒ GAS WELL ☐ OTHER ☐
2. Name of Operator Texaco E&P Inc.
3. Address of Operator P.O. Box 3109 Midland, TX 79702
4. Well Location Unit Letter H : 2310 Feet From The North Line and 987 Feet From The East Line Section 25 Township 17S Range 35E 34 NMPM Lea County
10. Elevation (Show whether DF, RKB, RT, GR, etc.) 3991' (GR)

11. Check Appropriate Box to Indicate Nature of Notice, Report, or Other Data:	
NOTICE OF INTENTION TO:	SUBSEQUENT REPORT OF:
PERFORM REMEDIAL WORK ☐	REMEDIAL WORK ☐
TEMPORARILY ABANDON ☐	COMMENCE DRILLING OPNS. ☐
PULL OR ALTER CASING ☐	CASING TEST AND CEMENT JOB ☐
OTHER: ☐	OTHER: ☐
PLUG AND ABANDON ☒	ALTERING CASING ☐
CHANGE PLANS ☐	PLUG AND ABANDONMENT ☐

12. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

1. Notify NMOCD of intent to plug & abandon prior to moving unit on well.
2. Note: well has 4 1/2 CIBP @ 4400 w/35' of cmt. 6-7-91
3. TIH w/tub to 3900. Spot 15 sxs cmt f/3900-3800 (Queens) W.O.C. & tag.
4. POOH to 3000. Spot 45 sxs cmt plug f/3000-2700 (Yates Btm salt) W.O.C. & tag.
5. POOH to 1800. Spot 15 sxs cmt plug f/1800-1700 (top salt) W.O.C. & tag.
6. POOH to 1648. Spot 15 sxs cmt plug f/1648-1548 (7-5/8 shoe)
7. POOH to 400. Spot 40 sxs cmt plug f/400-surface
8. Cut off wellhead & weld on cap & install dryhole marker.

25 SXS MINIMUM

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE RJ Harding III TITLE Operations Engineer DATE 10-4-94

TYPE OR PRINT NAME RJ Harding III TELEPHONE NO. 915-688-481

(This space for State Use)

OCT 12 1994

APPROVED BY _____ TITLE _____ DATE _____

CONDITIONS OF APPROVAL, IF ANY:

THE OIL CONSERVATION DIVISION HAS REVIEWED THE
PROPOSAL AND HAS DETERMINED THAT THE
PROPOSAL IS IN ACCORDANCE WITH THE
STATE OF NEW MEXICO OIL CONSERVATION
ACT AND RULES.