

STATE OF NEW MEXICO
ENERGY AND MINERALS DEPARTMENT

NO. OF COPIES RECEIVED	
DISTRIBUTION	
SANTA FE	
FILE	
U.S.G.S.	
LAND OFFICE	
OPERATOR	

OIL CONSERVATION DIVISION
P. O. BOX 2088
SANTA FE, NEW MEXICO 87501

Form C-103
Revised 10-1-78

5a. Indicate Type of Lease	
State <input type="checkbox"/>	Fee <input checked="" type="checkbox"/>
5. State Oil & Gas Lease No.	
-	

SUNDRY NOTICES AND REPORTS ON WELLS

(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR.
USE "APPLICATION FOR PERMIT -" (FORM C-101) FOR SUCH PROPOSALS.)

1. OIL WELL <input checked="" type="checkbox"/> GAS WELL <input type="checkbox"/> OTHER-	7. Unit Agreement Name
2. Name of Operator Read & Stevens, Inc.	8. Farm or Lease Name Hooper "A"
3. Address of Operator P.O. Box 1518, Roswell, New Mexico 88201	9. Well No. 1
4. Location of Well UNIT LETTER <u>I</u> <u>2121.4</u> FEET FROM THE <u>South</u> LINE AND <u>801.4</u> FEET FROM THE <u>East</u> LINE, SECTION <u>7</u> TOWNSHIP <u>19S</u> RANGE <u>35E</u> NMPM.	10. Field and Pool, or WHdcat Scharb Bone Spring
15. Elevation (Show whether DF, RT, GR, etc.) 3853.8' GR - 3865' RKB	12. County Lea

Check Appropriate Box To Indicate Nature of Notice, Report or Other Data
NOTICE OF INTENTION TO: SUBSEQUENT REPORT OF:

PERFORM REMEDIAL WORK <input type="checkbox"/>	PLUG AND ABANDON <input type="checkbox"/>	REMEDIAL WORK <input type="checkbox"/>	ALTERING CASING <input type="checkbox"/>
TEMPORARILY ABANDON <input type="checkbox"/>	CHANGE PLANS <input type="checkbox"/>	COMMENCE DRILLING OPNS. <input type="checkbox"/>	PLUG AND ABANDONMENT <input checked="" type="checkbox"/>
PULL OR ALTER CASING <input type="checkbox"/>	OTHER <input type="checkbox"/>	CASING TEST AND CEMENT JOBS <input type="checkbox"/>	

17. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

TD 10148'. 2 3/8" tubing fished and recovered to 5350'. 4 1/2" casing cut and pulled at 5343'. Plugged and abandoned as follows:

- Set 35 sx. cement plug across 4 1/2" casing stub from 5300' to 5400'.
- Set 35 sx. cement plug at top of Queen from 4580' to 4680'.
- Set 35 sx. cement plug across 8 5/8" casing shoe from 3925' to 4025'.
- Cut and pulled 8 5/8" casing.
- Set 50 sx. cement plug 50' above and 50' below 8 5/8" casing stub.
- Set 50 sx. cement plug across 12 3/4" casing shoe from 330' to 440'.
- Set 15 sx. surface plug and installed dry hole marker.

18. I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNED [Signature] TUCKER TITLE Production Clerk DATE 11/7/79

APPROVED BY [Signature] TITLE OIL & GAS INSPECTOR DATE 2-13-80

CONDITIONS OF APPROVAL, IF ANY:

RECEIVED
NOV - 9 1979
C.C.D. HOBBS. OFFICE