

ATTACHMENT C-103
NORTH VACUUM ABO UNIT #156W
API # 30-025-23696
PAGE 2

12-05-97 MIRU HES CT UT. FILLED CT W/F-WTR INSTALLED OS TO FISH PROB. RIH ON
CT TO 8610' FISHED PROB TBG PSI F/0# TO 1200#. EQUIP POOH W/PROB.
12-06-97 REMOVE PROB. RIH TO FISH VALUE, FISHED, POH REC. RDMO HESS EQUIP.
SECURED WELL, WO COMPLETION.

COMPLETION:

12-12-97 MIRU WELLCO RIG #91. ND TBG HANGAR, NU BOP, UNSET BKR INFLATABLE
PKR. FLOW DN, PUMP 50 BBL 10# BRINE, KILL TBG. POOH & LD PKR. PU
GUIBERSON UNI-VI PKR, SDFN, PKR SWINGING IN HOLE.
12-13-97 SITP 200#, SICP 150#, OPEN UP & BLEED OFF GAS. RIH W/ 2 7/8" TBG,
TESTING TO 7000 PSI, SET PKR @ 8280', TEST BACKSIDE TO 500 PSI-GOOD. ,
EOT @ 8621'. SDFN :& SUNDAY.
12-15-97 MIRU HALLIBURTON, PRESSURE TEST LINES TO 8000 PSI. ACIDIZE ABO
OPEN HOLE W/10,000 GALS 20% HCL, (8611-9413'), R/U TO FLOW BACK.
LEAVE OPEN TO TANK OVERNIGHT.
12-16-97 CONTINUE TO FLOW BACK. KILL TBG W/10# BRINE, POOH & LD 2 7/8" WS &
GUIB UNI-VI PKR. PU GUIB G6 PKR, RIH ON 2 7/8" TBG, FLOW TO TANK,
SDFN.
12-17-97 WELL MADE 100 BBL CN, 20 BBL OIL. RDMO WELLCO RIG #91, LEAVE BOP
ON WELL, SET HAND SLIPS, LEAVE FLOWING TO TANK.
12-19-97 MIRU WELLCO #91. R/U KILL TBG. PU & RIH W/ 2 7/8" TBG. SET GUIBERSON
G-6 PKR @ 8278', PRESSURE UP TO 500# ENSURE PKR SET. READY TO CIRC
PKR FLUID. SWI, SDFN.
12-22-97 R/U PUMP TRUCK, CIRC 190 BBL 1% FLUID. LATCH ONTO ON OFF TOOL. ND
BOP, NU TREE. TEST BACKSIDE TO 500# FOR 30 MIN ON CHART. GOOD TEST.
RDMO WELLCO RIG #91. TURN WELL TO PRODUCTION. PIT WILL BE
BACKFILLED WHEN PROD DIGS OUT INJECTION LINES.