

DISTRICT I
1625 N. French Dr., Hobbs, NM 88240
DISTRICT II
811 South First, Artesia NM 88210
DISTRICT III
1000 Rio Brazos Rd., Aztec, NM 87410
DISTRICT IV
2040 South Pacheco, Sante Fe, NM 87505

OIL CONSERVATION DIVISION
P.O. Box 2088
Santa Fe, New Mexico 87504-2088

WELL API NO. 30-025-23876
5. Indicate Type of Lease STATE ☒ FEE ☐
6. State Oil & Gas Lease No. B-1520

SUNDRY NOTICES AND REPORTS ON WELLS (DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS)	
1. Type of Well: Oil Well ☐ Gas Well ☐ Other injector	7. Lease Name or Unit Agreement Name Bridges State
2. Name of Operator Mobil Producing TX & NM, Inc.	
3. Address of Operator P. O. Box 4358 Houston TX 77210-4358	8. Well No. 167
4. Well Location Unit Letter O : 1980 Feet From The east Line and 660 Feet From The south Line Section 15 Township 17S Range 34E NMPH Lea County	9. Pool name or Wildcat Vacuum; Grayburg-San Andres
10. Elevation (Show whether DR, RKB, RT, GR, etc.)	

11. Check Appropriate Box to Indicate Nature of Notice, Report, or Other Data
NOTICE OF INTENTION TO:

PERFORM REMEDIAL WORK ☐ PLUG AND ABANDON ☐
TEMPORARILY ABANDON ☒ CHANGE PLANS ☐
PULL OR ALTER CASING ☐ MULTIPLE COMPLETION ☐
OTHER: ☐

SUBSEQUENT REPORT OF:

REMEDIAL WORK ☐ ALTERING CASING ☐
COMMENCE DRILLING OPNS. ☐ PLUG & ABANDONMENT ☐
CASING TEST AND CEMENT JOB ☐
OTHER: ☐

12. Describe proposed or completed operations. (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103. (For Multiple Completions: Attach wellbore diagram of proposed completion or recompletion)

1. MIRU. WSU. Blow off any pressure present. Lock and tag out all valves
2. ND wellhead and NU BOP and test.
3. Release 5-1/2" Baker tension packer @ 4630'. POOH with 2-3/8" tubing and 5-1/2" packer.
4. MIRU WLSU. RIH with 5-1/2" 15.5# gauge ring to 4625'. POOH with gauge ring. PU and RIH with 5-1/2" CIBP on electric line. Set CIBP @ approx. 4625'.
5. PU and RIH with dump bailer on wireline. Dump bail 35' of cement on top of CIBP @ 4625'. POOH with wireline and RDMO.
6. RIH with injection tubing to approx. 4580'. Pressure test annulus to 600 psi. If ok, circulate well with Baker Petrolite packer fluid. POOH and lay down 4414' of 2-3/8" tubing. Keep well full of fluid while tripping tubing. Leave 176' of kill string in the well. Land tubing in the wellhead with a 4' x 2-3/8" tubing sub.
7. RD BOP and NU wellhead. Test casing to 600 psi. If OK, notify the NMOCD and schedule an official MIT test.
8. Clean location. RDMO WSU.

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE *D. O. Howard* TITLE **Sr. Regulatory Specialist** DATE **09/05/2001**
TYPE OR PRINT NAME **Dolores O. Howard** TELEPHONE NO. **(713) 431-1792**

(This space for State Use)

APPROVED BY _____ TITLE _____ DATE _____

CONDITIONS OF APPROVAL IF ANY:

THE COMMISSION MUST BE NOTIFIED 24 HOURS PRIOR TO THE BEGINNING OF PLUGGING OPERATIONS FOR THE C-103 TO BE APPROVED.

