

STATE OF NEW MEXICO
ENERGY AND MINERALS DEPARTMENT

NO. OF COPIES RECEIVED	
DISTRIBUTION	
SANTA FE	
FILE	
U.S.G.S.	
LAND OFFICE	
OPERATOR	

OIL CONSERVATION DIVISION
P. O. BOX 2088
SANTA FE, NEW MEXICO 87501

Form C-103
Revised 10-1-78

SUNDRY NOTICES AND REPORTS ON WELLS

(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT -" (FORM C-101) FOR SUCH PROPOSALS.)

1. OIL WELL ☒ GAS WELL ☐ OTHER ☐	5a. Indicate Type of Lease State ☒ Fee ☐
2. Name of Operator Texaco Producing Inc.	5. State Oil & Gas Lease No. B-871-1
3. Address of Operator P.O. Box 728, Hobbs, New Mexico 88240	7. Unit Agreement Name North Vacuum Abc West Unit
4. Location of Well UNIT LETTER <u>D</u> <u>510</u> FEET FROM THE <u>North</u> LINE AND <u>660</u> FEET FROM THE <u>West</u> LINE, SECTION <u>34</u> TOWNSHIP <u>17-S</u> RANGE <u>34-E</u> NMPM.	8. Form or Lease Name
	9. Well No. 23
	10. Field and Pool, or Whidcat Vacuum Abc North
15. Elevation (Show whether DF, RT, GR, etc.) 4055 (DF)	12. County Lea

Check Appropriate Box To Indicate Nature of Notice, Report or Other Data
NOTICE OF INTENTION TO:

PERFORM REMEDIAL WORK ☐
TEMPORARILY ABANDON ☐
PULL OR ALTER CASING ☐
OTHER ☐

PLUG AND ABANDON ☐
CHANGE PLANS ☐
OTHER ☐

SUBSEQUENT REPORT OF:

REMEDIAL WORK ☒
COMMENCE DRILLING OPERATIONS ☐
CASING TEST AND CEMENT JOBS ☐
OTHER ☐
ALTERING CASING ☐
PLUG AND ABANDONMENT ☐

17. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

1. MIRU. Pull rods and pump. Install BOP. Pull tubing.
2. Swedge cut 5 1/2" casing at 4644-4900', POH. Clean out fill at 8740-8794' with 4 3/4" bit. POH.
3. TIH with packer. Spot 200 gals 20% NEFE across perforations at 8691-8790'. Set packer at 8493' with 126' of tailpipe.
4. Acidize perforations at 8691-8790' with 5800 gals 20% XL NEFE in two stages, with 400 lbs rock salt between stages. AIR 5 BPM, MAX TP 3000 psi, ISIP 1900 psi.
5. Release packer, tag PBTD at 8794', and POH.
6. Run production equipment, remove BOP, and return to production. 24 hour OPT 5-26-87 : 19 BO, 6 BW, 33 gravity, GOR 1700. Test prior to workover - 14 BO, 0 BW.

18. I hereby certify that the information above is true and complete to the best of my knowledge and belief.

393-4031

SIGNED A. Gernandt TITLE Area Superintendent DATE

Orig. Signed by
Paul Kautz
Geologist

APPROVED BY TITLE DATE

CONDITIONS OF APPROVAL, IF ANY:

JUN 5 1987

RECEIVED
JUN 4 1987
OCD
HOBBS OFFICE

RECEIVED
JUN 4 1987
OCD
HOBBS OFFICE