

STATE OF NEW MEXICO
ENERGY AND MINERALS DEPARTMENT

NO. OF COPIES RECEIVED	
DISTRIBUTION	
SANTA FE	
FILE	
U.S.C.S.	
LAND OFFICE	
OPERATOR	

OIL CONSERVATION DIVISION
P. O. BOX 2088
SANTA FE, NEW MEXICO 87501

Form C-103
Revised 10-1-78

SUNDRY NOTICES AND REPORTS ON WELLS

DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR.
USE "APPLICATION FOR PERMIT -" (FORM C-101) FOR SUCH PROPOSALS.

5a. Indicate Type of Lease	
State <input type="checkbox"/>	Fee <input checked="" type="checkbox"/>
5. State Oil & Gas Lease No.	
7. Unit Agreement Name	
8. Farm or Lease Name	
Nicholson	
9. Well No.	
1	
10. Field and Pool, or Wildcat	
Midway (ABO)	
12. County	
Lea	

1. OIL WELL <input checked="" type="checkbox"/> GAS WELL <input type="checkbox"/> OTHER <input type="checkbox"/>
2. Name of Operator
Vintage Petroleum, Inc.
3. Address of Operator
502 S. Main, Suite 400, Tulsa, OK 74103
4. Location of Well
UNIT LETTER <u>J</u> . <u>1879</u> FEET FROM THE <u>South</u> LINE AND <u>1980</u> FEET FROM THE <u>east</u> LINE, SECTION <u>10</u> TOWNSHIP <u>17S</u> RANGE <u>37E</u> NMPM.

15. Elevation (Show whether DF, RT, GR, etc.)

Check Appropriate Box To Indicate Nature of Notice, Report or Other Data
NOTICE OF INTENTION TO:

SUBSEQUENT REPORT OF:

PERFORM REMEDIAL WORK ☐
TEMPORARILY ABANDON ☐
PULL OR ALTER CASING ☐
OTHER ☐

PLUG AND ABANDON ☐
CHANGE PLANS ☐
OTHER ☐

REMEDIAL WORK ☐
COMMENCE DRILLING OPNS. ☐
CASING TEST AND CEMENT JOBS ☐
OTHER ☐

ALTERING CASING ☐
PLUG AND ABANDONMENT ☒
OTHER ☐

17. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

1. Move in and rig up. Pull tubing and rods out of hole.
2. Run 4½ C.I.B.P. Set @ 8800'. Dump 3 sks. of cement on top.
3. Go in hole with tubing, and displace hole with mud.
4. Come out of hole with tubing. Weld on to 4½ csg. 11.60 freepoint
5. Cut casing @ 4685' and laid down 133 jts.
6. Ran tubing to 6830'. Set 25 sks. plug. Set 30 sk. plug @ 4740'.
7. Wait 4 hrs. Tag plug @ 4605'.
8. Weld on. Cut and pull 8 5/8 @ 760'.
9. Laid down 19 jts. of 8 5/8 casing.
10. Set 8 5/8 45 sk. plug @ 830'.
1. Tag plug @ 682'. Spot 50 sk. plug @ 450'.
2. Tag plug @ 390'. Spot 30 sk. plug.
3. Spot 10 sks. of cement on top. Weld on plate and Install P & A marker.
4. Clean location.
5. Casing and tubing @ this date on location. Must fill cellar & pit.

8. I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNED Lucy Bahr Agent for:
TITLE Vintage Petroleum, Inc.

DATE 1-29-87

PROVED BY James H. Smith TITLE OIL & GAS INSPECTOR

DATE APR 5 1988

CONDITIONS OF APPROVAL, IF ANY:

RECEIVED
FEB 2 1987
OCD
HORE OFFICE