

STATE OF NEW MEXICO  
ENERGY AND MINERALS DEPARTMENT

NO. OF COPIES RECEIVED	
DISTRIBUTION	
SANTA FE	
FILE	
U.S.G.S.	
LAND OFFICE	
OPERATOR	

OIL CONSERVATION DIVISION  
P. O. BOX 2088  
SANTA FE, NEW MEXICO 87501

Form C-103  
Revised 10-1

SUNDRY NOTICES AND REPORTS ON WELLS

(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)

1. OIL WELL <input checked="" type="checkbox"/> GAS WELL <input type="checkbox"/> OTHER <input type="checkbox"/>	5a. Indicate Type of Lease State <input type="checkbox"/> Fee <input checked="" type="checkbox"/>
2. Name of Operator Vintage Petroleum, Inc.	5. State Oil & Gas Lease No.
3. Address of Operator 502 S. Main, Suite 400, Tulsa, OK 74103	7. Unit Agreement Name
4. Location of Well UNIT LETTER <u>J</u> <u>1879</u> FEET FROM THE <u>South</u> LINE AND <u>1980</u> FEET FROM THE <u>east</u> LINE, SECTION <u>10</u> TOWNSHIP <u>17S</u> RANGE <u>37E</u> NMPM.	8. Farm or Lease Name Nicholson
	9. Well No. 1
	10. Field and Pool, or Wildcat Midway (ABO)
15. Elevation (Show whether DF, RT, GR, etc.) 3751.0 GR	12. County Lea

Check Appropriate Box To Indicate Nature of Notice, Report or Other Data  
NOTICE OF INTENTION TO:

PERFORM REMEDIAL WORK <input type="checkbox"/>	PLUG AND ABANDON <input checked="" type="checkbox"/>	REMEDIAL WORK <input type="checkbox"/>	ALTERING CASING <input type="checkbox"/>
TEMPORARILY ABANDON <input type="checkbox"/>	CHANGE PLANS <input type="checkbox"/>	COMMENCE DRILLING OPNS. <input type="checkbox"/>	PLUG AND ABANDONMENT <input type="checkbox"/>
PULL OR ALTER CASING <input type="checkbox"/>	OTHER <input type="checkbox"/>	CASING TEST AND CEMENT JOB <input type="checkbox"/>	OTHER <input type="checkbox"/>

17. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

1. Move in and rig up. If necessary, strip rods out of hole and fish tubing. Pull tubing and pull out of hole @ 8859'.
2. Run 4½ C.I.B.P. to 8800' and pump 3 sks. of cement on top.
3. Go in hole with tubing and displace hole with mud.
4. Come out of hole with tubing and cut 4½ casing 11.6 lbs. @ free point.
5. Pull 4½ casing and set 50' plug in and out of casing stub.
6. If necessary, set 30 sks. plug @ Glorietta. @ 6830'.
7. Set 100' plug @ 4800'.
8. Pull 8 5/8 @ free point.
9. Set 100' plug and cut off 8 5/8 casing.
10. Set 10ft. plug @ surface. 100' PLUG ACROSS SURFACE PIPE
11. Install dry hole marker. Rig down unit. Clean location.
12. File report.

18. I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNED Jerry Sexton

Agent for:  
Vintage Petroleum, Inc.

DATE 12-30-86

ORIGINAL SIGNED BY JERRY SEXTON

APPROVED BY DISTRICT 1 SUPERVISOR

TITLE \_\_\_\_\_

DATE JAN 5 1987

CONDITIONS OF APPROVAL, IF ANY:

RECEIVED

JAN 5 1987

CCD  
HOBBS OFFICE