

STATE OF NEW MEXICO  
ENERGY AND MINERALS DEPARTMENT

NO. OF COPIES RECEIVED	
DISTRIBUTION	
SANTA FE	
FILE	
U.S.G.S.	
LAND OFFICE	
OPERATOR	

OIL CONSERVATION DIVISION  
P. O. BOX 2088  
SANTA FE, NEW MEXICO 87501

Form C-103  
Revised 10-1-

5a. Indicate Type of Lease  
State ☐ Fee ☒  
5. State Oil & Gas Lease No.

SUNDRY NOTICES AND REPORTS ON WELLS  
(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR.  
USE "APPLICATION FOR PERMIT -" (FORM C-101) FOR SUCH PROPOSALS.)

1. OIL WELL <input checked="" type="checkbox"/> GAS WELL <input type="checkbox"/> OTHER <input type="checkbox"/>	7. Unit Agreement Name
2. Name of Operator Vintage Petroleum, Inc.	8. Farm or Lease Name Nicholson
3. Address of Operator 502 S. Main, Suite 400, Tulsa, OK 74103	9. Well No. 2
4. Location of Well UNIT LETTER 0 766 FEET FROM THE South LINE AND 1874 FEET FROM THE east LINE, SECTION 10 TOWNSHIP 17S RANGE 37E N14PM.	10. Field and Pool, or Wildcat Midway (ABO)
15. Elevation (Show whether DF, RT, GR, etc.) 3759 KB	12. County Lea

Check Appropriate Box To Indicate Nature of Notice, Report or Other Data  
NOTICE OF INTENTION TO:

PERFORM REMEDIAL WORK ☐  
TEMPORARILY ABANDON ☐  
PULL OR ALTER CASING ☐  
OTHER ☐  
PLUG AND ABANDON ☒  
CHANGE PLANS ☐

SUBSEQUENT REPORT OF:

REMEDIAL WORK ☐  
COMMENCE DRILLING OPNS. ☐  
CASING TEST AND CEMENT JOBS ☐  
OTHER ☐  
ALTERING CASING ☐  
PLUG AND ABANDONMENT ☐

17. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

1. Move in and rig up. Strip rods out of hole. Pull tubing and 5½ packer @ 8704'.
2. Run 5½ B.I.B.P. to 8800' and pump 3 sks. of cement on top.
3. Go in hole with tubing and displace hole with mud.
4. Come out of hole with tubing. Cut 5½ 17#'s pressure @ free point.
5. Pull 5½ casing and set 50' plug in and out of stub.
6. If necessary, set 30 sk. plug @ Glorietta @ 6830'.
7. Set 100' plug @ 4750'.
8. Pull 8 5/8 24/32 lbs. @ free point.
9. Set 100' plug. Cut off 8 5/8 stub.
10. Set 10' plug @ surface. **100' PLUG ACROSS SURFACE PIPE**
11. Install dry hole marker. Rig down unit. Clean location.
12. File report.

18. I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNED Jerry Sexton Agent for:  
TITLE Vintage Petroleum, Inc.

DATE 11-30-86

ORIGINAL SIGNED BY JERRY SEXTON

APPROVED BY DISTRICT 1 SUPERVISOR

TITLE

DATE JAN 5 1987

CONDITIONS OF APPROVAL, IF ANY: